

Environmental Solutions

Assessment - Engineering - Management

ASBESTOS ABATEMENT MONITORING REPORT

**(UNDERGROUND TRANSITE PIPES)
(HARBOR GATEWAY)**

PREPARED FOR:

BOEING REALTY CORP.

PREPARED BY:

**MICHAEL REZVANI, REA, CAC
PRINCIPAL CONSULTANT**



Handwritten signature of Michael Rezvani, Principal Consultant, over a double-line horizontal separator.

AUGUST 27, 2001

Environmental Solutions

Assessment - Engineering - Management

August 27, 2001
Project No. ES00-005.Rpt

Mr. Johnny Marasco
Boeing Realty Corporation
3760 Kilroy Airport Way
Suite 500
Long Beach, California 90806

Class II Asbestos Abatement Monitoring Report
Underground Transite Conduit & Pipes (Phase III)
Boeing @ Gateway
19901 Normandie Avenue
Los Angeles, California

Introduction: Approximately 5000 feet of 4" and 5" diameter asbestos transite pipe encased in concrete were uncovered from underground at the subject site for abatement. The concrete encase asbestos transite pipes were placed in an assigned areas northeast and northwest of the subject site by Boeing's demolition contractors for proper handling, abatement and disposal. This report presents the results of our daily observations and air monitoring of the subsequent class II asbestos abatement performed by Tri-State Restoration, Inc. (aka, PDG, Tri-State). The abatement started on January 29, 2001 and completed on August 23, 2001.

Project Summary: Tri-State Restoration was retained by Boeing Realty Corporation to perform the class II asbestos abatement. The abatement was performed in accordance with the approved asbestos abatement specification prepared by Environmental Solutions for such project.

As a general state of practice, the transite pipes and conduit were cut-out by heavy equipment in transportable sections and placed in an area called the regulated work area (RWA) for abatement. This area was properly demarcated with caution tapes and was measured to be approximately 5,000 square feet. The RWA during the first phase of the project was located in the northeast of the subject site and during the second phase of the project, the RWA was removed and transported to the northwest of the site due to progression of the construction project.

Each concrete section containing transite pipes was carefully broken in sections which could be further handle by abatement personnel. The transite pipes were then separated from the surrounding concrete encasement, first, by the use of a large jack-hammer and then manually by asbestos abatement workers using hammer and chisel. In general, the process of this asbestos abatement included three different phases: 1) breaking the concrete, containing transite pipes while controlling the spread of transite pieces, 2) to separate and collect all pieces of transite pipe attached to the concrete encasement and properly disposing the transite in asbestos bags, and 3) to perform two final clearance sweeps of the RWA from east to west in order to find and collect much smaller pieces of transite prior to releasing the site to Boeing.

Environmental Solutions monitored the abatement activities on daily basis. The abatement activities were generally consistent and redundant in nature. Air samples were generally collected for determination of asbestos fiber concentration levels around RWA. Air samples were collected daily using low-flow air pumps at the northeast and the northwest corners which were in most cases downstream of the wind-flow from the RWA. The air samples were analyzed daily by phase contrast microscopy (PCM) using NIOSH 7400 method for detection of asbestos fibers in the filters. The air sampling documentation is presented in exhibit II of this report.

Final visual clearance was performed at the completion of the final sweep on August 23, 2001. The RWA was found to be free of visible pieces of transite debris. No assessment of the soil conditions was made or deemed warranted for this project. All transite materials were bagged and sealed and placed in an approved bin for transport to an approved land-filled by BDC transport (see attached hazardous manifests).

Conclusion: Tri-State workers were protected by tyvek suits, half-face respirators and hard hats for the duration of this project. No accident was observed or found recorded during this project. Visible emissions were kept to a minimum by the use of a water-tank truck used around and in the vicinity of the RWA. We believe that the abatement procedures were satisfactorily performed in accordance with 29 CFR 1926.1101 for handling and disposal of non-friable asbestos containing materials (class II) such as transite pipes.

The following exhibits are included and complete this report.

- o **Exhibit I** Field Reports
- o **Exhibit II** Air Sample Documentation
- o **Exhibit III** Hazardous Manifests

Environmental Solutions

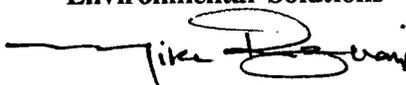

Michael Rezvani, REA, CAC
Senior Advisor & Principal Consultant



EXHIBIT I

FIELD REPORTS



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-0055

Project Name BOEING REALTY CORP.

Shift Start Date 01/29/2001

Project Location: N.E. CORNER / UGTP

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

- * 10:30 AM / TRI-STATE w/ A CREW OF SIX MEN ON-SITE.
- OUR OBSERVATIONS OF CONDITIONS INDICATE THE FOLLOWING;
- APPROXIMATELY 60 CUBIC YARDS OF ENCASE/CONCRETE BLOCKS OF TRANSITE HAS BEEN BROUGHT DOWN TO THE WORK AREA FROM BUILDING 3.
- THE NEW BLOCKS FROM BUILDING 3 ARE MARKED FOR "ID".
- THE LENGTH OF TIME OF COMPLETION HAS BEEN EXTENDED.
- THE RECENT RAINS HAVE CAUSED A SIGNIFICANT REDUCTION OF DUST EMISSIONS IN GENERAL.
- NO AIR/AMBIENT SAMPLING IS WARRANTED.
- THE WORK CONTINUES TO BE PERFORMED BY THE USE OF HEAVY EQUIPMENT.
- ACCORD VISITED THE SITE LAST THURSDAY & HAS FOUND THE GENERAL WORK AREA ACCEPTABLE.
- NO ACCIDENT IS REPORTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 01/30/2001

Project Location: N.E. CORNER / UGTP

Contractor: TEI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:00 AM / TEI-STATE W/ A FIVE-MAN CREW ON-SITE.

THE SCOPE OF WORK FOR THE WORK TODAY IS TO CONTINUE W/ THE SPECIFIED ABATEMENT @ THE REGULATED WORK AREA.

THE PROCESS OF BREAKING THE CONCRETE ENCASEMENT AROUND THE TRANSITE PIPES IS BEING PERFORMED W/ CARE ON A SPECIAL DROP CLOTH WHICH CONSISTS OF TWO LAYERS OF 10' FOLY ON TOP OF THE LAYER OF PLYWOOD WHICH IS PLACED ON A LARGE $\frac{1}{2}$ " THICK PLANE OR PLATE OF STEEL, FOR FIRMNESS.

NO PARTICULAR EMISSION FROM THIS PROCESS IS VISIBLE.

A MEMBER OF AQMD HAS VISITED THE SITE FOR INSPECTION OF PROCESSES IN THE AREA WHERE OTHER CONTRACTOR ARE CRUSHING BRICKS & CONCRETE. THE AQMD INSPECTOR HAS FOUND THE ASBESTOS ABATEMENT PROCESS SATISFACTORY.

MORE TRANSITE CONTAINING CONCRETE CASING IS BEING ADDED TO THE PILE ON REGULAR BASIS.

NO ACCIDENT WAS REPORTED DURING THIS SHIFT.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: PS00-005

Project Name BOENS REALTY CORP.

Shift Start Date 02/05/2001

Project Location: N.E. CORNER / UGTP

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM

DESCRIPTION:

- * 10:30 AM / TRI-STATE W/A SIX MAN CREW ON-SITE.
- OUR OBSERVATIONS INDICATE THE FOLLOWING:
- BAGS CONTAINING TRANSITE REMAIN IN RWA ALL SEALED.
- HAMMERING & BREAKING CONCRETE BLOCKS CONTAINING TRANSITE PIPE CONTINUE W/ HEAVY EQUIPMENT.
- SEPARATION OF CONC. & TRANSITE CONTINUES MANUALLY INSIDE RWA.
- THE RWA REMAINS MARKED W/ ACM SIGNS & BARRICADED.
- THE AREAS OUTSIDE OF RWA ARE AS BEFORE. NO CROSS CONTAMINATION BY TRANSITE HAS BEEN OBSERVED.
- NO ACCIDENTS ARE REPORTED
- THE ABATEMENT WORK APPEARS ABOUT 30% COMPLETE.
- THE CREW TAKES ONE LUNCH BREAK.
- THE ACM BIN IS ABOUT 50% FULL.

[Signature]
FIELD TECHNICIAN (Print Name)

MIKE REZVANI
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 02/07/2001

Project Location: N.E. CORNER / UGTP

Contractor: TEI-STATE

Weather Condition: CLEAR & MILD.

DESCRIPTION:

- * 11:00 AM / TEI-STATE w/ A SIX MAN CREW ON-SITE
- OUR TODAY'S OBSERVATIONS OF THE RWA INDICATES:
- * MANUAL CONCRETE BREAKING FOR TRANSITE RETRIEVAL CONTINUES
- * BAGS ARE LEFT @ RWA OUTSIDE. THESE BAGS CONTAIN TRANSITE PIPE PIECES & ARE SEALED CLOSED.
- * SEPARATION OF CONCRETE & TRANSITE CONTINUES MANUALLY INSIDE RWA.
- * THE WORK AREA REMAINS MARKED & BARRACATED.
- * TRUCK TRAFFIC IS CAUSING DUST EMISSIONS THAT BLOWN ACROSS RWA.
- * THE COMPLETION STU IS @ 30% POINT.
- * THE ONLY BIN @ N.E. CORNER IS 50% FULL.
- * NO ACCIDENT IS OBSERVED OR REPORTED.
- * THE ABATEMENT PROCESS & PERSONNEL PROTECTION APPEARED SATISFACTORY DURING THIS SHIFT.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 2/22/01

Project Location: UGTP

Contractor: TRI-STATE

Weather Condition: CLOUDY & WINDY

DESCRIPTION:

* 10:30 AM / TRI-STATE w/ A CREW OF 5 MEN ON-SITE.
 THE TRANSITE ABATEMENT IS IN PROGRESS.
 THE ABATEMENT COULD NOT BE PERFORMED LAST WEEK DUE TO RAIN & MUDDY CONDITIONS. ALSO LAST MONDAY 02/19/01 WAS NOT A WORK DAY & THEREFORE THE ABATEMENT WORK IS FALLING BEHIND. TODAY IS THE THIRD DAY OF PRODUCTIVE WORK. THE GROUND IS STILL MUDDY & SATURATED.
 THE BREAKING OF THE CONCRETE CASING CONTINUES W/ HEAVY EQUIPMENT & ABATEMENT CONTINUES W/ BY HAND. BAGS OF ASBESTOS ARE HAND CARRIED TO THE HOTBOX BIN.
 SEVERAL MANIFESTS HAVE BEEN EXECUTED & COPIES HAVE BEEN SUBMITTED TO US FOR PROPER FILING FOR THE FINAL REPORT.
 * NO VISIBLE EMISSIONS IS DETECTABLE ANYWHERE ON THE SITE.
 * NO ACCIDENT IS REPORTED OR OBSERVED.
 * COMPLETION RATE IS @ APPROX. 30%.
 * AIR SAMPLING IS NOT DEEMED NECESSARY.
 * TRI-STATE CONTINUES TO COLLECT PERSONAL AIR SAMPLES.

MIKE REZJANI
FIELD TECHNICIAN (Print Name)

Mike Rezjani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 01/16/2001

Project Location: UNDERGROUND TRANSITE

Contractor: TEI-STATE

Weather Condition: CLEAR & MILD.

DESCRIPTION:

* 10:15 AM / ENVIRO. SOLUTIONS ON-SITE. THE TEI-STATE CREW OF FIVE MEN IS ON-SITE. CONCRETE

THE WORK INCLUDES EXCAVATION OF ENCASED TRANSITE PIPES FROM UNDERGROUND & ABATING THE ASBESTOS CONTAINING TRANSITE PIPES. THE AREA OF WORK IS @ THE NORTHEAST CORNER OF THE SUBJECT SITE IN AN ISOLATION SECTION.

OUR OBSERVATIONS INDICATE, THAT THE REGULATED WORK AREA (RWA) HAS BEEN ESTABLISHED BY TEI-STATE & THE AREAS BEYOND THE RWA HAVE BEEN DEMARCATED & BARRIRED BY ASBESTOS TAPE & BARRELS.

SEVERAL HEAVY EQUIPMENT ARE USED FOR THE PROCESS OF THE EXCAVATION & SEPARATION & ABATEMENT.

THE BREAKING OF CONCRETE CASING TAKES PLACE ON A LARGE STEEL PLATE PLACED ON A 600 FT² - 800 FT² 20 MIL POLY. A LARGE JACK HAMMER BREAKS THE CONCRETE WHILE THE WORKERS PICK UP & SEPARATE THE ASBESTOS PIPES.

MUCH WATER IS USED IN THE PROCESS TO REDUCE EMISSIONS. THE WORKERS ARE PROTECTED BY / THERM SUITS, RESPIRATORS, GOGGLES, GLOVES, BOOTS & HARD HATS.

NO ACCIDENTS WERE OBSERVED OR REPORTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-205

Project Name BOEING REALTY CORP.

Shift Start Date 01/18/2001

Project Location: UNDERGROUND TRANSIT

Contractor: TRI-STATE

Weather Condition: CLEAR & COOL.

DESCRIPTION:

THE OBSERVATIONS INDICATE THE FOLLOWING;

* 10:40 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE W/ 5 MEN & A SUPERVISOR ON-SITE.

THE SCOPE OF WORK HAS NOT CHANGED.

THE BOUNDARIES OF THE RWA REMAINS IN PLACE.

WORK CONTINUES TO BE DONE BY HEAVY EQUIPMENT.

NO EMISSIONS OTHER THAN HAMMERING @ THE CONCRETE IS OBSERVED.

AIR SAMPLES COLLECTED ON TUESDAY DO NOT INDICATE ANY CONCENTRATION LEVELS GREATER THAN 0.01 f/c.

NO ACCIDENTS WERE REPORTED.

WORK IS @ 5% COMPLETION.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name GARBOING REALTY CORP.

Shift Start Date 01/22/2001

Project Location: UNDERGROUND TRANSITE

Contractor: TRI-SITE.

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:30 AM / ENVIRO. SOLUTIONS ON-SITE THE SCOPE OF WORK IS STILL UNCHANGED.

BLOCKS OF CONCRETE ARE BEING BROKEN BY HEAVY EQUIPMENT / C. JACK-HAMMER @ A BREAKING STATION & ACM TRANSITE PIECES ARE BEING COLLECTED & BAGGED BY THE CREW. THIS IS A SLOW PROCESS BUT IS DONE IN A SAFE MANNER.

THE CREW IS WELL PROTECTED & PLENTY OF WATER IS INCORPORATED INTO THE PROCESS.

NO AIR SAMPLING IS DEEMED NECESSARY SINCE NO CONTAINMENT IS APPLIED.

NO ACCIDENTS WAS REPORTED DURING THIS SHIFT.

10% OF PROJECT HAS BEEN ACCOMPLISHED.

MIKE REZIANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEWG REALTY CORP.

Shift Start Date 03/05/2001

Project Location: UGTPR

Contractor: TRI-STATE.

Weather Condition: CLOUDY & RAIN

DESCRIPTION:

* 10:30 AM / ENVIRO SOLUTIONS ON-SITE.

TRI-STATE w/ A FIVE-MAN CREW ON-SITE.

THE GROUND IS VERY WET & THE SOIL AROUND THE SITE HAS TURNED TO MUD.

TRI-STATE CREW IS TRYING TO GET THE HEAVY EQUIPMENT OPERATING AGAIN & PREPARE THE PWA.

THE BARRIER- ASBESTOS TAPES ARE REINFORCED.

& A FEW CONCRETE BLOCKS ARE PLACED @ CONCRETE BREAKING PAD.

THE RAIN CONTINUES TO FALL INTERMITTENTLY.

DURING THIS SHIFT FIVE BAGS OF TRANSITE PIPES WERE SEPARATED & PLACED IN THE BIN.

AIR MONITORING WAS NOT NECESSARY, SINCE NO EMISSIONS WERE PRESENT DUE TO RAIN.

NO ACCIDENTS WERE REPORTED.

NEXT SHIFT IS MARCH, 7TH.

Mike [Signature]
FIELD TECHNICIAN (Print Name)

MIKE PERZUANI
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 03/08/2001

Project Location: UG TPR

Contractor: TRI-STATE

Weather Condition: PARTLY CLOUDY

DESCRIPTION:

- * 10:40 AM / TRI-STATE w/ A CREW OF FIVE MEN ON-SITE.
- THE SCOPE OF WORK IS TO
- ◆ BREAK FIVE TO SEVEN LARGE CONCRETE BLOCKS &
- REMOVE ACM TRANSITE PIPE FROM THE BLOCKS & BAG-OUT.
- ◆ THE GROUND IS STILL MUDDY &/OR DAMP.
- ◆ NO EMISSIONS ARE DETECTED.
- ◆ NO AIR SAMPLES ARE NECESSARY.
- ◆ NO ACCIDENTS ARE REPORTED.
- ◆ WORKERS TOOK ONE LUNCH BREAK FOR ONE HOUR.
- ◆ ALL ACM REMOVED DURING THIS SHIFT IS BAGGED.
- ◆ THE ABATEMENT COMPLETION RATE IS @ 35%.
- ◆ ALL BARRIERS ARE INTACT & PNA IS RESTRICTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 03/12/2001

Project Location: UG/TRANSITE

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

- * ENVIRO. SOLUTIONS ON-SITE @ 10:50 AM.
- THE SCOPE OF WORK REMAINS THE SAME.
- ⊕ THE RNA BARRIERS ARE IN PLACE & ESTABLISHED.
- ⊕ THE CREW IS GETTING READY FOR LUNCH BREAK.
- ⊕ THE CREW IS UNWRAPPING ABOUT 5 LARGE BLOCKS FOR TRANSITE ABATEMENT EVERY DAY.
- ⊕ THE CHALKY SOILS ARE DRY & DUSTING IS A POSSIBILITY.
- ⊕ NO DUST EMISSIONS IS DETECTED IN/OR AROUND THE WORK AREA.
- ⊕ WORK CONTINUED AFTER LUNCH BREAK.
- ⊕ NO ACCIDENT IS REPORTED OR OBSERVED.
- ⊕ ALL REMOVED TRANSITE HAVE BEEN BAGGED & PLACED IN THE BIN.
- * 12:38 ENVIRO. SOLUTIONS OFF-SITE.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 03/15/2001

Project Location: UGTFF

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 12:00 / TRI-STATE W/ FIVE MEN ON-SITE.

ENVIRO. SOLUTIONS ON-SITE FOR MONITORING.

THE STATUS OF THE PROJECT HAS BEEN THE SAME.

TRI-STATE CONTINUES TO BREAK & ABATE ASBESTOS PIPES OUT OF 6 LARGE CONCRETE BLOCKS EVERY DAY.

THE WORKERS ARE PROTECTED W/ PERSONAL PROTECTIVE EQUIPMENT.

TODAY, THERE ARE MUCH GRADING & DIRT REMOVAL ACTIVITIES ADJACENT TO THE ASBESTOS ABATEMENT WORK AREA & SOME DUST IS MIGRATING INTO OUR WORK AREA AS THE RESULT.

NO VISIBLE DUST EMISSIONS IS DETECTED AS THE RESULT OF ABATEMENT.

NO ACCIDENT OR OTHER MISHAPS HAVE BEEN RECORDED OR NOTICED SO FAR.

THE WORK COMPLETION IS @ 45% POINT.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-025

Project Name BOEING REALTY CORP.

Shift Start Date 3/19/2001

Project Location: LIQTP ADJACEMENT

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM

DESCRIPTION:

* 10:30 AM / TRI-STATE W/ A CREW OF FIVE MEN ON-SITE.
THE SCOPE OF WORK IS UNCHANGED.

THE BREAKAGE OF THE LARGE BLOCKS OF CONCRETE W/
TELEPHONE PIPES CONTINUES.

TODAY THE WEATHER IS MUCH WARMER & DRY.

THE EMISSIONS ARE MORE VISIBLE FROM THE EXCAVATION AREA,
ADJACENT TO OUR WORK AREA.

THE JACK HAMMERING OF THE CONCRETE BLOCKS IN OUR WORK
AREA IS NOT RELEASING VISIBLE DUST EMISSIONS SINCE WATER
IS BEING USED BY TRI-STATE.

THE CREW TOOK ONE LUNCH BREAK @ 11:00 AM.

NO ACCIDENTS WERE REPORTED.

NO UNUSUAL OR MISHAP ACTS WERE OBSERVED.

PROJECT IS EXPECTED TO COMPLETE BY 30 MORE WORK SHIFT.

MIKE REZIANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY Corp.

Shift Start Date 3/20/2001

Project Location: UGTP ABATEMENT

Contractor: TRI-STATE

Weather Condition: PARTLY CLOUDY

DESCRIPTION:

* 10:45 AM / ENVIRO. SOLUTIONS ON-SITE.
 TRI-STATE w/ A SIX MAN CREW ON-SITE.
 SINCE YESTERDAY'S SHIFT, ABOUT 300 FEET OF CONCRETE
 BLOCKS CONTAINING ACM (TRANSITE) HAS BEEN BROUGHT OUT
 FROM UNDER-GROUND & ADDED ONTO THE RWA PILE.
 THIS WILL EXTEND THE LENGTH OF ABATEMENT WORK.
 THE CREW PERFORMS THE ABATEMENT PROCEDURES ACCORDINGLY.
 ONE AIR SAMPLE IS COLLECTED DOWNSTREAM OF WIND.
 THE CREW TOOK ONE LUNCH BREAK.
 NO ACCIDENT WAS OBSERVED OR REPORTED DURING THIS SHIFT.
 NO VISIBLE EMISSIONS WAS OBSERVED RISING FROM THE RWA.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 3/22/2001

Project Location: UGTP REMOVAL

Contractor: TRI-STATE

Weather Condition: PARTLY CLOUDY

DESCRIPTION:

* 10:40 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE w/ A CREW OF FIVE MEN ON-SITE.

THE OLD PILE OF CONCRETE & THE NEWLY ADDED WORK-
PILE IS ARE SAGGATED.

THE COMPLETION RATE OF THE ORIGINAL PILE OF TRANSITE
IS @ 70% & THE NEW PILE HAS NOT BEEN WORKED ON.

DUST EMISSIONS CONTINUE TO BE VISIBLE FROM THE GRADING
AREA SOUTH OF THE RWA.

THE WORKERS ARE PROTECTED & THERE ARE/IS NO VISIBLE
EMISSIONS FROM THE ASBESTOS WORK AREA.

DUE TO DUST FROM THE GRADE/ CONSTRUCTION AREA, TRI-STATE
IS NOT COLLECTING PERSONAL AIR SAMPLES FOR TIME BEING

NO ACCIDENTS REPORTED THIS SHIFT.

THE WORK IS PROGRESSING WELL.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 03/26/01

Project Location: UGTP ABRATEMENT

Contractor: TRI-STATE

Weather Condition: CLEAR & BREEZY

DESCRIPTION:

* 11:00 AM / TRI-STATE w/ A SIX-MAN CREW ON-SITE.
THE WINDS ARE BLOWING OUT OF SOUTH/SOUTHWEST &
THUS, SOME DUST FROM THE SOUTH OF THE PROPERTY IS
VISIBLE @ TIMES.

THE SCOPE OF WORK REMAINS THE SAME.

THE CREW IS TAKING LUNCH BREAK @ THIS TIME.

THE RWA APPEARS TO BE IN ORDER.

THE TRANSITE BREAKING AREA IS ALSO IN GOOD ORDER.

THE PROGRESSES IN GOOD MANNER.

NO ACCIDENT WAS REPORTED DURING THIS SHIFT.

ONE AIR SAMPLE WAS COLLECTED @ DOWNSTREAM OF RWA

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 03/28/2001

Project Location: UGTP ABATEMENT

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:38 AM / TRI-STATE w/A CREW OF SIX MEN ON-SITE.

OUR OBSERVATIONS INDICATE THE FOLLOWING;

• THE RWA IS SECURED & DEMARKATED.

• THE RWA IS BEING KEPT WET TO PREVENT DUST EMISSIONS BECOMING VISIBLE.

• TRI-STATE SUBMITTALS THREE HAZ. MAT MANIFESTS & ONE NON-HAZ. MANIFEST FOR FLING.

• THE WINDS ARE OUT OF THE SOUTH & THE GRADING ACTIVITIES TO THE SOUTH ARE CREATING LOTS OF DUST.

• THE CREW TAKES ON LUNCH BREAK.

• COMPLETION RATE OF THE FIRST PHASE IS @ 70%.

THE WORK ON THE SECOND PHASE HAS NOT STARTED.

• NO ACCIDENTS WERE RECORDED.

• NO ADVERSE CONDITIONS EXISTS.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 03/29/01

Project Location: UGIP REMOVAL

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

- * 10:30 AM / ENVIRO. SOLUTIONS ON-SITE.
- TRI-STATE w/ A CREW OF SIX ON-SITE.
- WORK AS VISUALLY OBSERVED INDICATE THE FOLLOWING
- ALL FIVE WORKERS ARE @ PWA CONDUCTING CARBON DIOXIDE BREAKAGE OF CONC. BLOCKS, SEPARATING TRANSITE PANELS BAGGING ACM, TRANSPORTING BAGS & KEEPING ORDER.
- MEETING w/ J. MAZASCO ABOUT PROGRESS REPORT.
- ONE AIR SAMPLE IS COLLECTED D.S.
- THE GENERAL WORK AREA IS DUSTY.
- NO VISIBLE EMISSIONS DETECTABLE FROM THE ABATEMENT AREA.
- NO ACCIDENTS REPORTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-025

Project Name BOEING REALTY CORP.

Shift Start Date 4/3/2001

Project Location: UGTP REMOVAL

Contractor: TEL-STATE

Weather Condition: CLEAR/PC & COOL BREEZY.

DESCRIPTION:

*10:40 AM/ TEL-STATE W/ A CREW OF THREE MEN ON-SITE.
 THE SCOPE OF WORK REMAINS THE SAME.
 THE CREW'S WORK REMAINS TO BE REMOVAL BY SEPARATION
 & BAGGING.
 THE WORK IS PROGRESSING RATHER SLOWLY DUE TO WINDY/
 BREEZY & COOL CONDITIONS.
 NO GRADING ACTIVITIES ARE OBSERVED ON THE ADJACENT
 PARTS.
 NO EMISSIONS ARE OBSERVED FROM THE RUNA OF THE
 ADJACENT WORK AREAS.
 ONE LUNCH BREAK IS TAKEN BY CREW.
 NO ACCIDENTS SEEN OR REPORTED.
 ONE MONITORING AIR SAMPLE COLLECTED.

THIRU REVANU
FIELD TECHNICIAN (Print Name)

Thiru Revanu
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOBING REALTY CORP.

Shift Start Date 04/05/2001

Project Location: UGTP ADJUSTMENT

Contractor: TRI-STATE

Weather Condition: P/C & COOL / BREEZ

DESCRIPTION:

* 10:48 AM / TRI-STATE w/ A CREW OF FIVE MEN ON-SITE.

THE SCOPE OF WORK REMAINS THE SAME.

SINCE LAST WEEK, THE CREW HAS BEEN WORKING ON THE NEWLY UNCOVERED TRANSITE PIPES.

THE WEATHER IS COLD & BREEZY, THE GRADING WORK IS BEING DONE TOO FAR AWAY FROM THE ASBESTOS RWA & THEREFORE AIR-SAMPLING WAS SATISFACTORILY PERFORMED w/ GOOD RESULTS.

NO ACCIDENTS WERE REPORTED.

THE CREW TOOK ONE LUNCH BREAK & TWO SMALL/SHORT BREAKS.

MIKE REZ-VANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 04/09/01

Project Location: UGIP REMOVAL

Contractor: TEI-STATE

Weather Condition: CLEAR TO P/C BREEZE
E. COOL.

DESCRIPTION:

* 10:30 AM / ENVIRO. SOLUTIONS ON-SITE.

TEI-STATE w/ A CREW OF FIVE ON-SITE.

THE CREW IS STILL WORKING ON THE ORIGINAL SCOPE OF ABATEMENT WHICH IS THE FIRST LARGE PILE OF TRANSIT PIPES.

THE COMPLETION RATE OF THE ORIGINAL PILE IS EXPECTED TO FINISH BY APRIL 25TH. THEY ARE @ A 85% COMPLETE RATE @ THIS TIME.

THE PROCESS OF ABATE APPEARS TO BE RUNNING WELL W/O INCIDENT.

THE GROUND REMAINS TO BE SOMEWHAT WET FROM RAIN SHOWERS ON FRIDAY NIGHT & SATURDAY.

DUST EMISSIONS APPEAR TO BE MINIMAL & BLOWING AWAY FROM THE PVA.

ONE AIR SAMPLE IS COLLECTED.

NO ACCIDENTS ACCURED OR RECORDED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 4/10/2001

Project Location: UGTP Removal

Contractor: TRI-STATE

Weather Condition: CLEAR & COOL.

DESCRIPTION:

* 10:30 AM / TRI-STATE w/ A CREW OF SIX ON-SITE.
 ALL APPEARS TO BE IN GOOD CONDITION.
 SINCE THE CREW IS PREPARING TO TAKE LUNCH BREAK,
 I CAN DISCUSS THE PROJECT W/ THEM.
 THE DEMOLITION CONTRACTOR HAS UNCOVERED ANOTHER 100'
 OF TRANSITE BLOCKS FROM THE DEMO-SITE.
 THE CONTRACTOR IS TO BRING THE LOAD TO THE RWA FOR
 ABATEMENT.
 WINDS ARE OUT OF WEST TODAY & JUST EMISSIONS FROM
 THE EXCAVATION & DEMO SITE IS VISIBLE.
 NO VISIBLE EMISSIONS IS VISIBLE FROM THE ABATEMENT
 WORK AREA OR THE RWA.
 NO ACCIDENT WAS REPORTED
 ONE AIR SAMPLE WAS COLLECTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-025

Project Name BOEING REALTY CORP.

Shift Start Date 4/11/2001

Project Location: UGTP REMOVAL

Contractor: TRI-STATE

Weather Condition: P/C & COOL

DESCRIPTION:

* 10:40 AM / TRI-STATE w/ A CREW OF SIX MEN - SITE.

THE SCOPE OF WORK REMAINS THE SAME FOR TODAY;

DUE TO THE CLOUDY SKY, THE DUST EMISSIONS FROM THE ADJACENT AREA TO RWA IS NOT VISIBLE.

THE CREW WORKS IN HARMONY & RATHER SLOWLY DUE TO THE NATURE OF WORK.

ACCESS TO THE RWA IS NOW LIMITED TO THE GATE ON THE WEST SIDE & THEREFORE LESS TRAFFIC DUST IS INTRODUCED TO THE WORK AREA.

• THE CREW TOOK ONE LUNCH BREAK & ONE SHORT BREAK.

• NO ACCIDENT WAS OBSERVED OR REPORTED.

• ONE AIR SAMPLE WAS COLLECTED.

• TRI-STATE PLANS TO BLACK-POLY THE PROPERTY FENCE AROUND THE RWA.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-0057

Project Name BOEING REALTY CORP.

Shift Start Date 4/17/2001

Project Location: UGTP REMOVAL

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM

DESCRIPTION:

* 10:00 AM / TRI-STATE w/ A CREW OF SIX MEN ON-SITE.
 THE SCOPE OF WORK IS UNCHANGED.
 TRI-STATE HAS INSTALLED A PLASTIC (GREEN) VISUAL BARRIER
 AROUND THE REG. WORK AREA / RNA. THIS IS A GOOD IDEA.
 ONE AIR SAMPLE WAS COLLECTED B/W 10:15 & 11:15 AM.
 NO VISIBLE EMISSION WAS DETECTED.
 NO ACCIDENTS HAVE BEEN REPORTED.
 FEW ADDITIONAL HAZ. MANIFESTS ARE ACCUMULATED FOR
 PROCESSING.
 PERSONAL AIR SAMPLES FROM TRI-STATE WILL BE ANALYZED
 BY ENVIRO. SOLUTIONS.
 THE CREW IS WORKING A 10 HR. SHIFT.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 4/13/2001

Project Location: UGTP REMOVAL

Contractor: TRI-STATE

Weather Condition: PCLOUDY & BREEZY

DESCRIPTION:

* 10:40 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE w/ A CREW OF SIX MEN ON-SITE.

THE ABATEMENT ACTIVITIES CONTINUE AS BEFORE.

THE PROCESS HAS PICKED UP PACE.

ONE AIR SAMPLE WAS COLLECTED ON THE EAST SIDE OF THE
RVA DOWNSTREAM OF ACTIVITIES.

NO ACCIDENTS WERE REPORTED.

NO ADVERSE CONDITIONS EXIST.

CRITICAL BARRIERS / VISUAL BARRIERS ARE WELL IN PLACE.

* 1:40 PM / ENVIRO. SOLUTIONS OFF-SITE.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-0205

Project Name BOEING REALTY CORP.

Shift Start Date 4/19/2001

Project Location: UGTP REMOVAL

Contractor: TRI-STATE

Weather Condition: P. CLOUDY & COOL

DESCRIPTION:

* 12:00 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE W/ A CREW OF SIX MEN ON-SITE.

WE HAVE BEEN INFORMED BY JOHNNY MARASCO & TRI-STATE THAT MORE UNDER GROUND TRANSITE WATER PIPES HAVE BEEN UNCOVERED FROM THE SUBJECT SITE & DUG-UP BY THE DEMO/GRADING CONTRACTOR.

THE PIPE IS APPROX. 4,000 - 4,500 FEET LONG & MAY BE EXPECTED TO BE AROUND THE PERIMETER OF THE SITE & IT IS ABOUT 12" IN DIAMETER.

THE BIG PIECES OF THE PIPE ARE PLACED IN ALREADY PREPARED DUMPSTERS & BURIED WRAPPED BY TRI-STATE FOR DISPOSAL.

ONE AIR SAMPLE WAS COLLECTED OUTSIDE OF WORK AREA/DNA.

NO ACCIDENTS WERE REPORTED.

NO ADVERSE CONDITION IS PRESENT.

ALL WORKERS ARE PROTECTED.

MIKE REZMAN
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 4/23/01

Project Location: UGTP Removal

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:05 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE W/ A CREW OF SIX MEN ON-SITE. THE WORK IS COMPRISED OF TWO PARTS. AS FOLLOWS:

• PROPER REMOVAL OF WATER TRANSITE PIPES.

• PROPER HANDLING & REMOVAL OF ELECT. TRANSITE PIPE FROM THE PRESENT RWA.

• ONE AIR SAMPLE IS COLLECTED ONA

• NO VISIBLE EMISSIONS DETECTED.

• NO ACCIDENT SEEN OR REPORTED.

• ONE DREPPED BIN IS ON-SITE FOR ALL TRANSITE PIECES.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 4/25/2001

Project Location: UGTP REMOVAL SECT.

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:00 AM / TRI-STATE W/ A CREW OF SIX (6) MEN ON-SITE.

THE SCOPE OF WORK IS UNCHANGED.

THE CREW CONTINUES TO SEPARATE TRANITE PIPES / COND. FROM ITS CONCRETE BLOCK ENCASUREMENT.

ONE AIR SAMPLE IS COLLECTED ONA.

NO VISIBLE EMISSIONS DETECTED.

NO ACCIDENT SEEN OR REPORTED BY TRI-STATE.

THE PROJECT COMPLETION IS @ 75% POINT.

THE CREW TOOK ONE LUNCH BREAK B/W 11: TO 12: NOON.

THE WINDS ARE CALM & TO JUST IS MIGRATING FROM THE ADJACENT CONSTRUCTION AREA.

* 1:30 PM / ENVIRO. SOLUTIONS OFF-SITE.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 4/21/2001

Project Location: UGTP REMOVAL SECTION

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:38 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE w/ A CREW OF SIX PEOPLE ON-SITE.

THE WINDS ARE CALM & OUT OF WEST & SOUTH WEST.

EMISSIONS ARE NOT VISIBLE @ THIS TIME.

THE CREW IS WORKING SLOWLY & CAUTIOUSLY.

THE ASBESTOS BIN REMAINS ON-SITE

NO EMISSION FROM THE REGULATED WORK AREA IS MADE VISIBLE.

ONE AIR SAMPLE IS COLLECTED USING LOW-FLOW AIR PUMP @

OUTSIDE OF WORK AREA JUST NORTHEAST OF THE RWA.

NO ACCIDENT WAS SEEN OR REPORTED.

THE PROJECT IS ABOUT 85% - 90% COMPLETE FOR THIS PHASE.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 4/30/2001

Project Location: UGTP REMOVAL

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD BREEZE
N.W.

DESCRIPTION:

* 10:40 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE w/ ITS CREW OF FIVE WORKERS ON-SITE.

THE ABATEMENT OF TRANSITE CONDUITS / PIPE IN THIS SECTION OF THE PROPERTY / RWA CONTINUES.

THE WINDS ARE OUT OF NORTHWEST.

JUST SOUTH OF THE RWA / WORK AREA, AN EXCAVATOR IS MOVING SOIL. SOME OF THE VISIBLE EMISSIONS FROM THIS WORK IS ENTERING RWA.

THE RWA CONTINUES TO BE ISOLATED w/ VISUAL BARRIERS.

ONE SHORT AIR-SAMPLE IS COLLECTED OUTSIDE OF THE RWA.

THIS PART / OF THE PROJECT IS ABOUT 90% COMPLETE.
PHASE

NO ACCIDENT WAS OCCURED OR REPORTED DURING THIS SHIFT.

NO VISIBLE EMISSION FROM THE RWA IS REPORTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 5/1 & 5/2/2001

Project Location: UGTP / REMOVAL

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD.

DESCRIPTION:

*10:00 AM / TRI-STATE w/ A CREW OF FIVE MEN ON-SITE
DURING YESTERDAY (5/1) & TODAY, THE LOCATION OF OUR REGULATED
WORK AREA (RWA) HAS CHANGED.

BOEING IS RELOCATING OUR WORK AREA TO THE OPPOSITE SIDE / OR
WEST SIDE OF THE SITE.

ALL TRANSITE / CONCRETE BLOCKS ARE BEING TRANSPORTED OUT TO THE
WEST & NORTH-WEST CORNER.

TRI-STATE'S JOB FOR THE NEXT COUPLE OF DAYS WILL BE TO
ESTABLISH A NEW RWA & RESUME ABATEMENT.

NO AIR MONITORING DEEMED NECESSARY.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 5/10/2001

Project Location: USIP / REMOVAL

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD.

DESCRIPTION:

* 10:15 AM / TRI-STATE w/ A CREW OF FIVE ON-SITE.
 THE CREW'S SCOPS OF WORK HAS REMAINED THE SAME.
 THE RWA HAS EXPANDED TO SUPPLY A LARGER AMOUNT
 OF TRANSITS BLOCKS OF ACM.
 THE CREW IS WORKING CONSISTENTLY IN THE SAME AREA.
 NIKING DEMOLITION CONTRACTOR HAS DEMOBILIZED THEIR
 EQUIPMENT & MATERIALS FROM THE SITE. THEREFORE
 NOY DUST/VISIBLE IS OBSERVED.
 ONE AIR SAMPLE WAS COLLECTED DOWNSTREAM OF WORK AREA.
 NO ACCIDENT WAS REPORTED.
 WORK PROGRESS W/O ANY ADVERSE CONDITION.
 THE AREA HAS VISUAL BARRIER.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name: BOEING / UGTP REMOVAL

Shift Start Date 5/14/ - 5/15/2001

Project Location: NORTH WEST CORNER

Contractor: TRI-STATE

Weather Condition: OVERCAST

DESCRIPTION:

* 10: AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE w/ A CREW OF FIVE MEN ON-SITE.

THE SCOPE REMAINS TO BE

REMOVAL & SEPARATION OF TRANSITE ASBESTOS FROM THE CONCRETE BLOCKS & DISPOSING THE MATERIALS AS ACM.

THE WORK ON BOTH DAYS APPEARS TO BE CONSISTENT IN ACTIVITIES.

NO ADVERSE CONDITIONS EXIST.

THE WORK PERFORMED BY TRI-STATE IS THE ONLY WORK REMAINING ON THIS PROPERTY.

THE CREW TOOK ONE LUNCH BREAK & ONE REG. BREAK.

NO ACCIDENT WAS OBSERVED OR RECORDED DURING THE SHIFTS.

ONE AIR SAMPLE WAS COLLECTED EACH DAY @ DOWNSTREAM OF WORK ACTIVITIES.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE (DATE)



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING / UGTP REMOVAL

Shift Start Date 5/21/2001

Project Location: N.W. CORNER

Contractor: TRI-STATE

Weather Condition: OVERCAST & COOL

DESCRIPTION:

* 10:15 AM/ ENVIRO SOLUTIONS ON-SITE.

TRI-STATE W/ A CREW OF FIVE MEN ON-SITE.

OUR OBSERVATIONS INDICATE THE FOLLOWING;

- 1) THE ZWA @ N.W. CORNER IS RESTRICTED & SECURED.
- 2) ALL HEAVY EQUIPMENT ARE IN GOOD WORKING CONDITION.
- 3) THE WORK AREA IS DEMARKATED WELL.
- 4) THE BINS ARE PREPPED W/ POLY. MOST BINS ARE EMPTY.
- 5) THE WORK AREA HAS A VISUAL BARRIER.

THE WORK IS PROGRESSING W/O INCIDENT.

NO EMISSION OF DUST IS DETECTED.

THE WORKERS ARE WELL PROTECTED.

ENVIRO. SOLUTIONS COLLECTS TWO (2) AIR SAMPLES @ DIS. OF WORK AREA AS MONITORING SAMPLES.

NO ACCIDENTS WERE REPORTED.

ONE LUNCH BREAK WAS TAKEN BY TRI-STATE WORKERS.

MIKE PEZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name: BOYING REALTY CORP.

Shift Start Date: 5/22 - 5/24/2001

Project Location: UGTP REMOVAL

Contractor: TBL-STATE

Weather Condition: OVERCAST TO CLEAR

DESCRIPTION:

* 10:00 AM/ ON EACH DAY OUR VISIT INDICATED THE FOLLOWING

* TBL-STATE W/ A CREW OF FIVE MEN ON-SITE.

AS NORMAL STATE OF PRACTICE, THE CREW IS PROTECTED W/ RESPIRATORY PROTECTION, HARD HATS, T-SHIRT SUITS, GOGGLES & BOOTS.

* LARGE PIECES OF TRANSITE CONTAINING CONCRETE WERE BROUGHT FROM THE WEST SIDE OF THE RWA W/ A LARGE BOLDZER. THE SAME MACHINE BREAKS THE BLOCK & THEN THE CREW MANUALLY REMOVES THE TRANSITE FROM THE CONC. THE ASBESTOS TRANSITE PIECES ARE PLACED IN BAGS & THE CONCRETE IS TRANSPORTED OUT OF THE RWA TO A PILE AREA. OTHER DRILLING ACTIVITIES ARE ALSO IN PROGRESS IN THE AREA BUT NO VISIBLE DUST EMISSION IS OBSERVED.

THE WINDS ARE GENERALLY OUT OF WEST & NORTHWEST.

* WE COLLECT ONE AIR SAMPLE DURING EACH MONITORING PHASE.

FROM THE OWA/DEWA.

THE CREW TAKES BREAKS FOR LUNCH EACH DAY FOR ONE HR.

NO ACCIDENT HAS BEEN REPORTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date ES00-005/29/2001

Project Location: UGTP Removal / N.W. Cor.

Contractor: TRI-STATE

Weather Condition: CLEAR & BREEZY

DESCRIPTION:

* 10:00 AM / ENVIRO. SOLUTIONS ON-SITE

TRI-STATE w/ A CREW OF FIVE MEN ON-SITE.

THE PERSONNEL OF THE SUBJECT CREW HAS NOT CHANGED.

THE SCOPE & EXECUTION OF WORK HAS NOT CHANGED.

ALL APPEARS TO BE IN ORDER.

DUST EMISSION IS VISIBLE BUT THIS DUST IS NOT FROM ACTIVITIES RELATED TO ASBESTOS ABATEMENT.

THE WINDS ARE OUT OF THE N.WEST & WEST.

SIX 40 TPD BINS ARE HERE ON-SITE & PREPPED.

THE BAGS CONTAINING ACM/TRANSITE ARE PLACED INSIDE OF THESE BINS.

ONE SHORT DURATION AIR SAMPLE IS COLLECTED OUTSIDE OF RWA.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 5/30 & 5/31/01

Project Location: N.W. CORNER/UGIT

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:30 AM/ TRI-STATE w/ A CREW OF FIVE ON-SITE.
ENVIRO. SOLUTIONS ON-SITE.

THE SCOPE OF WORK REMAINS THE SAME FOR THE
CONTRACTOR.

THE BREEZE IS BLOWING FROM THE WEST/N. WEST & THE
GENERAL WORK AREA IS DUSTY.

THE WORK AREA IS TAPED & ISOLATED.

WE MET w/ JOHNNY MARASCO @ THE SITE & DISCUSS THE
PROJECT'S PROGRESS.

NO ACCIDENTS REPORTED THIS SHIFT.

ONE AIR SAMPLE WAS TAKEN @ DOWNSTREAM ON EACH
DAY'S VISIT.

MIRSA REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 6/4/2001

Project Location: ULTP REMOVAL / NEW.

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:20 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE W/ A CREW OF FIVE MEN ON-SITE.

THE PROJECT STATUS IS AS FOLLOWS;

- * THE CREW IS IN THE PROCESS OF TRANSPORTING LARGE CONCRETE PIECES CONTAINING ASBESTOS TRANSITE CONDUIT FROM ONE SIDE OF THE WORK AREA TO THE BASIC CUTTING / BREAKING AREA.
- * THE REMOVED &/OR SEPARATED ASBESTOS TRANSITE IS PLACED INSIDE PLASTIC BAGS & BROUGHT IN A SAFE CORNER & THEN BAGS ARE TIED & PLACED INSIDE THE HOTARD BIN.
- * TRI-STATE COLLECTS PERSONAL AIR SAMPLES.
- * ENVIRONMENTAL SOLUTIONS COLLECTS AIR SAMPLES (1) OUTSIDE OF THE WORK AREA
- * NO ACCIDENT WAS RECORDED DURING THIS SHIFT.
- * WE DISCUSSED THE PROJECT'S PROGRESS W/ TRI-STATE ON SITE.

* 1:30 PM / ENVIRO. SOLUTIONS OFF-SITE.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name: BOEING REALTY CORP.

Shift Start Date 6/5-7/2001

Project Location: N.W. @ UGIP REMOVAL

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:30 AM / TRI-STATE w/ A CREW OF FIVE MEN ON-SITE.
 ENVIRO. SOLUTIONS ON-SITE.

THE SCOPE OF WORK MAY HAVE EXPANDED BECAUSE MORE
 TRANSIT PIPES HAVE BEEN UNCOVERED ON THE OTHER SIDE OF
 THE SITE WHERE SOIL UNCOVERING IS GOING ON.

THE PROJECT PROGRESSES NORMALLY.

THE COMPLETION RATE IS @ 75-80% & GETTING LESS.

THE GENERAL WORK AREA IS DUSTY & DUST REMAINS
 A VISIBLE PART OF THE PROJECT.

WATER IS USED AROUND THE IMMEDIATE WORK AREA.

NO ACCIDENTS ARE REPORTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 6/13-6/14/2001

Project Location: UGTP ABATE / N.W. CORN.

Contractor: TRI-STATE

Weather Condition: CLEAR F. MILD

DESCRIPTION:

* 10:30 AM / ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE W/A CREW OF FIVE MEN HAS BEEN ON SITE ON BOTH DAYS.

THE SCOPE OF WORK REMAINS THE SAME FOR BOTH WEDNESDAY & THURSDAY.

OUR OBSERVATIONS ON BOTH DAYS INDICATE NO BREAK OF ACTIVITIES OF ADVERSE CONDITIONS.

ON WEDNESDAY, 6/13/2001, GERALD ADKINSON INFORMED US ABOUT TWO PEOPLE WHO WERE PHOTOGRAPHING THE RWA.

SINCE TRI-STATE IS ADHERING TO THE SPECIFICATION, WE DO NOT BELIEVE THERE IS ANY REASON FOR CONCERN.

PREVAILING WINDS ON BOTH DAYS WERE FROM THE WEST.

THE GROUND REMAINS DRY FOR THE MOST PART & THUS THE DUST IS EMINENT.

NO INJURIES RECORDED OR REPORTED DURING THESE TWO DAYS.

ONE AIR SAMPLE WAS COLLECTED EACH DAY @ DOWNSTREAM OF RWA.

MIKE REZVANI

FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOBING REALTY CORP.

Shift Start Date 6/11-6/12/2001

Project Location: UGTP ADATE / N.W. CORN.

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:05 / AM ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE W/ A CREW OF FIVE MEN ON-SITE.

THE SCOPE OF WORK REMAINS THE SAME FOR BOTH, MONDAY & TUESDAY.

OUR OBSERVATIONS ON BOTH DAYS DO NOT INDICATE ANY ADVERSE CONDITIONS OR ANY BREACH FROM THE ORIGINAL SCOPE OF WORK.

PREVAILING WINDS ON BOTH DAYS WERE FROM THE WEST.

THE GROUND IS DRY & DUST IS EMINENT.

NO INJURIES RECORDED OR REPORTED DURING THESE TWO DAYS. ONE AIR SAMPLE WAS COLLECTED EACH DAY @ DOWNSTREAM OF REG. WORK AREA (R-WA).

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature] 6/12/01
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 6/18-6/19/01

Project Location: UGTP REMOVAL / N.W.

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM

DESCRIPTION:

THIS REPORT PRESENTS THE CONDITIONS @ THE SITE FOR THE SUBJECT PROJECT, ON THE 6/18 & 6/19.

* 10:55 AM/ ENVR. SOLUTIONS ON-SITE.

TRI-STATE W/A CREW OF FIVE MEN ON-SITE.

THE SCOPE OF WORK FOR THESE TWO DAYS IS TO CONTINUE TO SEPARATE TRANITE FROM CONCRETE & DISPOSE OF EACH ACCORDINGLY.

THE CONSTRUCTION CREW ON THE EAST SIDE OF THE WORK AREA HAS BROUGHT MORE CONCRETE & TRANITE TO THE SITE.

THIS MAY AN ADDITIONAL ONE WEEK TO THE LENGTH OF THE PROJECT. THE LAND REMAINS DRY & JUSTY, BUT THE BLOCK-BREAKING PROCESS IS JUST FREE.

EMISSIONS DOWN TO NON VISIBLE.

NO INJURIES REPORTED OR OBSERVED.

ONE AIR SAMPLE WAS COLLECTED @ THE EQUIPMENT ROOM.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOBING REALTY CORP.

Shift Start Date 6/20-6/21/01

Project Location: UGTP REMOVAL / N.W.

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM

DESCRIPTION:

* 10:30 AM / THIS REPORT PRESENTS THE CONDITIONS @
THE SUBJECT SITE FOR THE SUBJECT PROPERTY ON THE
WORK DAY OF JUNE 20 & JUNE 21.

@ 10:30 AM WE WERE ON SITE.
TRI-STATE W/ A CREW OF FIVE MEN ON-SITE.

THE SCOPE OF WORK FOR THE TWO DAYS WAS TO CONTINUE
TO BREAK CONCRETE BLOCKS, SEPARATE THE TRANSITE
PIPE/CONDUIT FROM THE CONCRETE & DISPOSE OF ACCORDWGLY.
NO INJURIES REPORTED.

TRI-STATE INFORM US THAT SEVEN MORE WEEKS OF
WORK REMAINS.

ONE AIR SAMPLE WAS COLLECTED ON EACH DAY.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 6/25-6/26/01

Project Location: UGTP Removal / N.W.

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM

DESCRIPTION:

*E/10:30 AM/ ENVIRO. SOLUTIONS ON-SITE.

TRI-STATE W/ A CREW OF 5 MEN ON-SITE.

THE SCOPE OF ABATEMENT REMAINS THE SAME.

THE CONDITIONS REMAIN THE SAME.

10 MORE CUBIC YARD OF THE CONCRETE BLOCKS

WERE BROKEN & PROCESSED SINCE LAST FRIDAY.

ENVIRO. SOLUTIONS IS ANALYZING THE PERSONAL AIR

SAMPLES FOR TRI-STATE.

NO ACCIDENTS OR INJURY HAVE BEEN REPORTED.

ONE AIR SAMPLE WAS COLLECTED EACH DAY.

Mike Rezvani
 FIELD TECHNICIAN (Print Name)

Mike Rezvani
 SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 6/28-7/2/2001

Project Location: UGIP REMOVAL / N.W.

Contractor: TRI-STATE

Weather Condition: CLEAR TO P.C.

DESCRIPTION:

* 10:05 AM / TRI-STATE W/ A CREW OF FIVE ON-SITE.

ENVIRO. SOLUTIONS ON-SITE.

THE SCOPE OF WORK IS UNCHANGED

THE CONCRETE BROCKEN PIECES & OTHER DEBRIS, ACCUMULATES ON THE EAST SIDE. THE CONCRETE w/ ASBESTOS REMAINS ON THE WEST SIDE.

TEN TONS OF CONCRETE & ASBESTOS HAVE BEEN BROCKEN UP & PROCESSED.

ON THURSDAY 6/27/01, TWO MORE HAZARDOUS MANIFESTS WERE PROCESSED & SUBMITTED TO US FOR DOCUMENTATION.

THE ABATEMENT APPEARS TO BE RUNNING WELL.

NO ACCIDENT WAS RECORDED.

NO MUDHAPS OR ANY BREACH OF SLOPE WAS OBSERVED.

ONE AIR SAMPLE WAS COLLECTED EACH DAY FOR AIR MONITORING PROCESS ONLY.

MICHAEL TEZVANI
FIELD TECHNICIAN (Print Name)

[Signature] 7/2/01
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 7/9/2001

Project Location: N.W. UGTR ABATE

Contractor: TRI-STATE

Weather Condition: CLEAR/WARM/BREEZY.

DESCRIPTION:

* 10:10 AM / ENVIRO. SOLUTIONS ON-SITE.

~~EN~~ TRI-STATE w/ A CREW OF SIX MEN ON-SITE.

THE CREW DID NOT WORK LAST THURSDAY.

WE OBSERVE THE CREW @ THIS TIME TO BE BREAKING CONCRETE & SEPARATING FROM TRANSITE PIPE/CONDUIT.

WINDS ARE STRONG OUT OF THE WEST.

NO DUST EMISSION IS OBSERVED FROM THE WORK AREA.

CREW TAKES LUNCH BREAK @ 11:00 AM.

TWO AIR SAMPLES COLLECTED OUTSIDE OF THE WORK AREA.

NO ACCIDENTS WERE OBSERVED OR REPORTED.

ONE MAN IS SUBSTITUTING FOR G. ADERSON FOR TODAY ONLY.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 7/10-7/11/2001

Project Location: N.W. UGTP ARATE

Contractor: TRI-STATE

Weather Condition: CLEAR & BREEZY

DESCRIPTION:

* 10:00 AM / ENVIRO-SOLUTIONS ON-SITE.
 TRI-STATE HAS SIX MEN ON-SITE.
 THE SCOPE OF WORK FOR THIS WEEK IS A CONTINUATION OF WORK.
 THERE IS STILL MUCH WORK TO BE DONE.
 A LARGE PILE OF CONCRETE BLOCKS REMAINS ON-SITE.
 TRI-STATE IS CONTINUING TO USE HEAVY EQUIPMENT IN ORDER TO BREAK THE CONCRETE.
 THE SURFACE OF THE LAND REMAINS DRY & DUST FROM THE NON-ACM/DWA REMAINS EMINENT.
 TRI-STATE CREW TAKES ONE LUNCH BREAK & RETURNS TO WORK @ 12:15 PM.
 NO ACCIDENTS WERE REPORTED ON EITHER DAYS.
 ONE AMBIENT AIR SAMPLE WAS COLLECTED EACH DAY.
 THE PROJECT APPEARS 80-85% COMPLETE.
 FOUR MORE WEEKS IS ANTICIPATED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name: BOEING REALTY CORP.

Shift Start Date: 7/16/2001

Project Location: N.W. TP REMOVAL

Contractor: TRI-STATE

Weather Condition: P. CLOUDY, E. MILD

DESCRIPTION:

* 10:05 AM / ENVIRO SOLUTIONS ON-SITE.

TRI-STATE W/A CREW OF SIX MEN ON-SITE.

OUR OBSERVATIONS INDICATE THE FOLLOWING:

• THE HEAVY HAMMER IS BREAKING CONCRETE BLOCKS

• A TWO (2) MAN CREW IS MANUALLY BREAKING THE SMALLER PIECES OF CONCRETE TO SEPARATE THE ASBESTOS TRANSITE.

• THE SUPERVISOR IS COLLECTING PERSONAL AIR SAMPLES.

• THE WATER TRUCK IS WETTING THE AREA.

• VISIBLE EMISSION OF DUST ARE NOT EVIDENT FROM OUR WORK AREA.

• ENVIRO. SOLUTIONS COLLECTS ONE AMBIENT AIR SAMPLE.

• WE DISCUSSED THE PROJECT PROGRESS W/ G. ATKERSON.

• NO ACCIDENT WAS RECORDED OR OBSERVED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE / DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 7/17-7/19/2001

Project Location: N.W. CORNER

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:00 AM / ENVIRA. SOLUTIONS ON-SITE.
 TRI-STATE W/ A CREW OF SIX MEN ON-SITE.
 THE WORK CONTINUES W/O ANY CHANGES IN THE SCOPE.
 THE AIR SAMPLING STRATEGY CHANGED A LITTLE.
 ON TUESDAY ONLY ONE AIR SAMPLE WAS COLLECTED.
 ON MONDAY & WEDNESDAY, TWO AIR SAMPLES WERE COLLECTED.
 AND TODAY ONE AIR SAMPLE IS BEING COLLECTED OUTSIDE OF
 THE RWA PERIMETER.
 JOHNNY MARASCO W/ BOEING IS HERE ON-SITE TO OBSERVE &
 CHECK THE PROGRESS.
 NO ACCIDENT WAS OBSERVED OR RECORDED.
 EMISSIONS OF DUST IS BEING CONTROLLED TO A MINIMUM.
 ONE BREAK & ONE LUNCH-BREAK WAS TAKEN BY THE CREW.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 7/23-7/25/2001

Project Location: N.W. CORNER

Contractor: TRI-STATE

Weather Condition: CLEAR & MILD.

DESCRIPTION:

* 10:30 AM / TRI-STATE w/ A CREW OF SIX MEN ON-SITE.
 ENVIRO. SOLUTIONS ON-SITE.
 THE SITUATION @ THE SITE REMAINS UNCHANGED.
 THE WINDS ARE BLOWING OUT OF SOUTH WEST ON BOTH
 DAY & TEMP. IS MILD.
 THE ONLY DUST EMISSION IS FROM THE STREET ON THE
 WEST SIDE OF THE SITE.
 BREAKING & SEPARATING THE CONCRETE FROM THE TRANSITE.
 THE TOOK ONE W/CH BREAK FOR BOTH DAY.
 ON 7/25/2001, JOHNNY MARASCO W/ BOEING VISITED
 THE SITE FOR PROGRESS OF ACTIVITIES.
 ONE AIR SAMPLE WAS TAKEN EACH DAY.
 NO ACCIDENT WAS OBSERVED OR NOTED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 7/30 - 8/1/2001

Project Location: N.W. CORNER / TRANSITE

Contractor: TRI-STATE

Weather Condition: CLEAR / MILD / BREEZY

DESCRIPTION:

* 10:30 AM / ENVIRO. SOLUTIONS ON-SITE ON ALL THREE DAYS.

TRI-STATE w/ A CREW OF FOUR MEN ON-SITE.

THE WORK APPEARS TO BE PROGRESSING @ A FASTER PACE.

SOME OF THE ATTENTION OF TRI-STATE IS FOCUSED ON THE TRANSPORTING THE CONTAMINATED SOILS ON THE EAST END OF THE PROJECT.

THE WINDS ARE @ OUT OF SOUTH WEST & WEST ON ALL THREE DAYS OF WORK.

ACCORDING TO OUR OBSERVATIONS, ABOUT 90% OF THE ABATEMENT HAS BEEN ACCOMPLISHED.

NO ACCIDENT HAS BEEN OBSERVED OR RECORDED.

ONE AIR SAMPLE WAS COLLECTED EVERY DAY.

MICHAEL REZVANI

FIELD TECHNICIAN (Print Name)

SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 8-6-2001

Project Location: N.W. CORNER / TP ABATE

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM

DESCRIPTION:

* 10:40 PM / TRI-STATE W/A CREW OF EIGHT (8) MEN ON-SITE.
 ENVIRO. SOLUTIONS ON-SITE. TWO MORE MEN ARE LATER ADDED.
 THE SCOPE OF WORK IS UNCHANGED.
 WE ARE INFORMED THAT THE ABATEMENT IS 90% FINISHED.
 TRI-STATE ESTIMATED ANOTHER 3-4 WEEKS OF WORK
 ON-SITE.
 TWO AIR SAMPLES @ PARALLEL POSITIONS ARE COLLECTED.
 NO ACCIDENT WAS OBSERVED OR RECORDED FOR THE PERIOD
 OF OBSERVATION.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

FIELD REPORT

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 8/7 & 8/8/2001

Project Location: N.W. CORNER TP ABATE

Contractor: TRI-STATE

Weather Condition: CLEAR/WARM

DESCRIPTION:

* 10:22 AM/ ENVIRO. SOLUTIONS ON-SITE FOR BOTH DAYS.

TRI-STATE HAS CUT DOWN ON THE NUMBER OF THE CREWS &

@ THIS TIME HAS FIVE (5) MEN ON-SITE.

THE SCOPE OF WORK HAS BEEN UNCHANGED.

THE CREW IS CONTINUING WITH THE BREAKING OF CONCRETE &

SEPARATING THE ASBESTOS FROM THE CONCRETE & BAGGING THE ACM

TRANSITE IN CLEAR PLASTIC BAGS.

THE DUST FROM THE SOUTHER HALF OF THE PROPERTY IS AFFECTING

THE DUST EMISSION LEVELS IN THE ASBESTOS RWA.

THE CREW TAKES ONE LUNCH BREAK EACH DAY.

NO ACCIDENT WAS OBSERVED ON EITHER DAYS.

ONE AMBIENT (OWA) AIR SAMPLE WAS COLLECTED EACH DAY

BY ENVIRO. SOLUTIONS.

NO BREACH OF SCOPE HAS BEEN OBSERVED.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

Mike Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 8/9 - 8/13/2001

Project Location: N.W. TP ABATEMENT

Contractor: TEI-STATE

Weather Condition: CLEAR & MILD

DESCRIPTION:

* 10:00 AM / TEI-STATE w/A CREW OF FIVE MEN ON-SITE.
 THE SCOPE OF WORK IS UNCHANGED.
 THE WORK IS 90% - 95% COMPLETE.
 WINDS ARE OUT OF THE WEST & N.WEST & DUST CONTINUES TO BE A PROBLEM.
 THE REGULATED WORK AREA CONTINUES TO BE WEATED & DUST EMISSIONS UNDER CONTROLLED ENVIRONMENT.
 ENVIRO. SOLUTIONS COLLECTS ONE AIR SAMPLE EACH DAY.
 THE AIR SAMPLE ANALYSES CONTINUE TO INDICATE FIBER CONCENTRATION LEVELS THAT ARE BELOW PERMISSIBLE EXPOSURE LIMIT (PEL).
 NO ACCIDENT WAS OCCURED OR OBSERVED DURING THE PAST TWO SHIFTS.

MICHAEL REZVANI
FIELD TECHNICIAN (Print Name)

Mik Rezvani
SIGNATURE/DATE



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

FIELD REPORT

2601 E. Chevy Chase Drive, Glendale, CA 91206

Job No.: ES00-005

Project Name BOEING REALTY CORP.

Shift Start Date 8/15-8/20/2001

Project Location: N.W. CORNER/TPR.

Contractor: TRI-STATE

Weather Condition: CLEAR & WARM.

DESCRIPTION:

⊕ 10:30 AM/ ENVIRO SOLUTIONS ON-SITE ON WORK CONDUCTED DURING THIS WEEK. TRI-STATE W/ A CREW OF FIVE MEN & SUPERVISOR ON-SITE ALL DAYS OF THE WEEK. BY WEDNESDAY 8/15/2001 ALL WORK ASSOCIATED W/ BREAKING OF CONCRETE & SEPARATING TRANSITE PIPES HAD BEEN COMPLETED.

THE REMAINING WORK SCOPE IS TO SWEEP BY VISUAL INSPECTION THE ENTIRE WORK AREA & PICK UP ALL REMAINING PIECES OF TRANSITE ON THE GROUND.

TODAY ON MONDAY 8/20/2001, THE REMAINS TO BE:

- ⊕ CLEARING ALL RESIDUAL DEBRIS FROM SITE.
 - ⊕ ABATING ANY ADDITIONAL FINDING OF TRANSITE BY CONTRACTORS.
 - ⊕ DEMOBILIZING AFTER SUBSTANTIAL COMPLETION.
- NO ADDITIONAL AIR SAMPLING DEEMED NECESSARY. OUR OBSERVATIONS DID NOT INDICATE ANY ACCIDENT OR RECORDED INJURIES.

MIKE REZVANI
FIELD TECHNICIAN (Print Name)

[Signature]
SIGNATURE/DATE

EXHIBIT II

AIR SAMPLING REPORTS



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: EJ00-005

PROJECT NAME: BOBING REALTY

CLIENT: BOBING REALTY CORP.

CONTRACTOR: TRI-STATS

PROJECT MANAGER: MIKE REZVANI

TECHNICIAN: _____

SAMPLE NO	DATE	PUMP #	DURATION		VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			TIME ON	TIME OFF					
A-01	1/16/01	LF01	10:40	120	360	OWA / D.S.	TRANSITE	<0.015/u	
		3ℓ/m	12:40				REMOVAL	MR	
A-02	1/18/01	LF01	10:45	120	360	OWA / D.S.	TRANSITE	<0.015/u	
		3ℓ/m	12:45				REMOVAL	MR	
A-03	1/22/01	LF01	10:50	90	360	OWA / D.S.	TRANSITE PIPE	<0.015/u	
		4ℓ/m	12:20				REMOVAL	MR	
A-04	3/05/01	LF01	10:40	120	480	OWA / D.S.	TRANSITE PIPE	<0.015/u	
		4ℓ/m	12:40				REMOVAL	MR	
A-05	3/8/01	LF01	10:45	90	270	OWA / D.S.	TRANSITE PIPE	<0.015/u	
		3ℓ/m	12:15				REMOVAL	MR	
A-06	3/12/01	LF01	10:47	120	360	OWA / D.S.	TRANSITE PIPE	<0.015/u	
		3ℓ/m	12:47				REMOVAL	MR	
A-07	3/15/01	LF01	10:35	120	360	OWA / D.S.	TRANSITE PIPE	<0.015/u	
		3ℓ/m	12:35				REMOVAL	MR	
A-08	3/19/01	LF01	10:50	60	180	OWA / D.S.	TRANSITE PIPE	<0.015/u	
		3ℓ/m	11:50				REMOVAL	MR	



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES00-005

PROJECT NAME: BOEING REALTY/UGTR CLIENT: BOEING REALTY CORP.

CONTRACTOR: TRI-STATE

PROJECT MANAGER: MAKRE REZVANI TECHNICIAN: _____

SAMPLE NO	DATE	PUMP #	TIME		VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			ON	OFF					
A-09	03/26/01	LF1	11:05	90	270	DOWNSTREAM	TRANSITE PIPE	<.01	1/2
		3 1/2	12:35			OWA	REMOVAL	MR	
A-10	3/28/01	LF1	10:47	60	180	" "	" "	.09	1/2 .13
		3 1/2	11:47			" VERT	DUSTY	MR	
A-11	4/5/01	LF1	10:50	90	240	" "	" "	<.01	1/2
		3 1/2	12:10			" "	" "	MR	
A-12	4/9/01	LF1	10:43	60	180	" "	" "	.019	1/2
		3 1/2	11:43			" "	" "	MR	
A-13	4/10/01	LF1	10:50	120	360	" "	" "	.051	1/2
		3 1/2	12:50			" "	" "	MR	
A-14	4/11/01	LF4	10:30	80	240	OWA	TRANSITE PIPE	.050	1/2
		3 1/2	12:10			DOWNSTREAM	REMOVAL	MR	
A-15	4/14/01	LF1	10:21	60	180	" "	" "	.047	1/2
		3 1/2	11:21			" "	" "	MR	
A-16	4/17/01	LF1	10:15	60	180	" "	" "	.061	1/2
		3 1/2	11:15			" "	" "	MR	



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES20-005

PROJECT NAME: UGTP REMOVAL

CLIENT: BOBING REALTY CORP.

CONTRACTOR: TEI-STATE

PROJECT MANAGER: MIKE REZMANI

TECHNICIAN: _____

SAMPLE NO	DATE	PUMP #	TIME		DURATION	VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			ON	OFF						
A-17	4/18/01	LF1	10:50		60	180	OWA / D.S. NORTH EAST	MONITORING	0.047 f/c	
		3 p/m	11:50						MR	
A-18	4/19/01	LF1	10:08		70	210	" "	" "	0.059 f/c	
		3 p/m	11:18						MR	
A-19	4/23/01	LF1	10:16		60	180	" "	" "	0.66 f/c	
		3 p/m	11:16						MR	
A-20	4/25/01	LF1	10:08		60	180	" "	" "	0.080 f/c	
		3 p/m	11:08						MR	
A-21	4/26/01	LF2	10:38		100	400	" "	" "	0.39 f/c	
		4 p/m	12:18						MR	
A-22	5/1/01	LF1	10:31		70	280	OWA DOWNSTREAM NORTH	" "	0.015 f/c	
		4 p/m	11:21						MR	
A-23	5/10/01	LF1	10:38		70	280	" "	" "	0.043 f/c	
		4 p/m	11:48						MR	
A-24	5/14/01	LF1	10:07		120	360	" "	MONITORING	0.033 f/c	
		3 p/m	12:07						MR	



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES 00-005 PROJECT NAME: Boeing/VGTP Removal CLIENT: BOEING REALTY CORP.
 CONTRACTOR: TR-1-STATE PROJECT MANAGER: MIKE RELVANI TECHNICIAN: _____

SAMPLE NO	DATE	PUMP #	TIME ON TIME OFF	DURATION	VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
A-25	5/15	LF1	10:09	90	270	DOWNSTREAM	MONITORING	0.01 1/4	
		30/m	11:38			WIND / NORTH	CLASS II	MR	
A-26	5/16	LF1	10:15	120	360	"	"	0.015 1/4	
		30/m	12:15			"	"	MR	
A-27	5/17	LF1	10:32	80	240	"	"	0.022 1/4	
		30/m	11:42			"	"	MR	
A-28	5/21	LF1	10:40	100	250	DOWNSTREAM	MONITORING	0.015 1/4	
		2.50/m	12:20			N.W. CORNER		MR	
A-29	5/21	LF2	10:40	100	250	"	"	0.020 1/4	
		2.50/m	12:30			"	"	MR	
A-30	5/22	LF1	10:31	110	275	"	"	0.043 1/4	
		2.50/m	12:21			"	"	MR	
A-31	5/23	LF2	10:15	120	360	"	"	0.011 1/4	
		30/m	12:15			"	"	MR	
A-32	5/24	LF1	10:30	90	240	"	"	0.050 1/4	
		30/m	11:50			"	"	MR	



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES00-005

PROJECT NAME: UGTP ABATEMENT

CLIENT: BOENK REALTY CORP.

CONTRACTOR: TRI-STATE

PROJECT MANAGER: MIKE REZVANI

TECHNICIAN: _____

SAMPLE NO	DATE	PUMP #	TIME ON / TIME OFF		DURATION	VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
A-33	5/29	LF1	10:31	12:00	120	360	DOWNSTREAM	MONITORING	0.044 f/c	MR
			3 1/2	12:31						
A-34	5/30	LF2	10:40	12:10	90	180	" "	"	0.062 f/c	MR
			2 1/2	12:10						
A-35	5/31	LF1	10:43	12:42	120	360	" "	"	0.069 f/c	MR
			3 1/2	12:42						
A-36	6/4	LF4	10:40	12:40	120	360	" "	"	0.061 f/c	MR
			3 1/2	12:40						
A-37	6/5	LF1	10:52	12:52	120	360	" "	"	0.40 f/c	MR
			3 1/2	12:52						
A-38	6/5	LF2	10:50	12:30	100	300	" "	"	0.071 f/c	MR
			3 1/2	12:30						
A-39	6/4	LF4	10:50	12:30	100	300	" "	"	0.041 f/c	MR
			3 1/2	12:30						
A-40	6/7	LF1	10:42	12:22	100	300	" "	"	0.033 f/c	MR
			3 1/2	12:22						



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES00-005

PROJECT NAME: ULTRASTATE PDES

CLIENT: BOEING HEAVY CORP.

CONTRACTOR: TRI-STATE

PROJECT MANAGER: MIKE REWANI

TECHNICIAN: _____

SAMPLE NO	DATE	PUMP #	DURATION		VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			TIME ON	TIME OFF					
A-41	6/11/01	LF1	10:20	100	300 lt	DOWNSTREAM	AIR MONITORING	0.044 1/2	
		3 l/m	12:00			S.W. COR. PWA	REMOVAL CLASS II	MR	
A-42	6/12/01	LF2	10:24	100	300 lt	" "	" "	0.031 1/2	
		3 l/m	12:04			" "	" "	MR	
A-43	6/13/01	LF1	10:32	110	330 lt	" "	" "	0.048 1/2	
		3 l/m	12:22			" "	" "	MR	
A-44	6/14/01	LF2	10:40	100	200 lt	" "	" "	0.030 1/2	
		2 l/m	12:120			" "	" "	MR	
A-45	6/18/01	LF1	10:42	100	200 lt	Q CLEAN RM	" "	0.040 1/2	
		2 l/m	12:22			AREA/US	" "	MR	
A-46	6/19/01	LF1	10:48	110	220 lt	" "	" "	0.012 1/2	
		2 l/m	12:38			" "	" "	MR	
A-47	6/20/01	LF1	10:35	100	200 lt	" "	" "	0.027 1/2	
		2 l/m	12:15			" "	" "	MR	
A-48	6/21/01	LF2	10:40	120	240 lt	" "	" "	0.047 1/2	
		2 l/m	12:40			" "	" "	MR	



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES00-005

PROJECT NAME: UGTP REMOVAL

CLIENT: BOEING REALTY CORP.

CONTRACTOR: TRI-STATE

PROJECT MANAGER: MIKE REZVANI

TECHNICIAN: _____

SAMPLE NO	DATE	PUMP #	DURATION		VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			TIME ON	TIME OFF					
A-49	LF1/25 06	LF1	10:40	100	200	NEAR CLN RM	AMB. AIR	0.050 f/c	
		2 l/m	12:10			AREA / ORWA	MONITORING	MR	
A-50	6/26	LF2	10:43	90	270	" "	" "	0.053 f/c	
		3 l/m	12:13			" "	" "	MR	
A-51	6/27	LF2	10:22	100	300	" "	" "	0.001 f/c	
		3 l/m	12:02			" "	" "	MR	
A-52	7/2/01	LF2	10:07	120	360	" "	" "	0.0031 f/c	
		3 l/m	12:07			" "	" "	MR	
A-53	7/9/01	LF2	10:17	110	330	" "	" "	0.0047 f/c	
		3 l/m	12:07			" "	" "	MR	
A-54	7/9/01	LF1	10:17	110	330	" "	" "	0.0040 f/c	
		3 l/m	12:07			" "	" "	MR	
A-55	7/10/01	LF1	10:14	90	270	" "	" "	0.0023 f/c	
		3 l/m	11:44			" "	" "	MR	
A-56	7/11/01	LF1	10:07	90	270	" "	" "	0.0051 f/c	
		3 l/m	11:39			" "	" "	MR	



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES00-005

PROJECT NAME: UGTP ABATEMENT

CLIENT: BOEING REALTY CORP

CONTRACTOR: TRI-STATE

PROJECT MANAGER: MIKE REZVANI

TECHNICIAN: MIKE REZVANI

SAMPLE NO	DATE	PUMP #	TIME ON		DURATION	VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			TIME ON	TIME OFF						
A-57	7/16/01	LF1	10:13	11:03	110	220	N.W. OF THE	MONITORING	0.0114/μ	
		2 l/m	12:03				WORK ARE	TRANSITE ABATE	MR	N/A
A-58	7/16/01	LF4	10:14	11:04	110	220	WEST OF THE	" "	0.0204/μ	
		2 l/m	12:04				WORK ARE	" "	MR	
A-59	7/17/01	LF1	10:22	12:02	120	360	" "	" "	0.0128/μ	
		3 l/m	12:22				" "	" "	MR	
A-60	7/18/01	LF1	10:08	11:28	120	240	" "	" "	0.0184/μ	
		2 l/m	12:08				" "	" "	MR	
A-61	7/18/01	LF2	10:09	11:09	110	220	" "	" "	0.0108/μ	
		2 l/m	11:59				" "	" "	MR	
A-62	7/19/01	LF1	10:18	11:18	100	200	" "	" "	0.0084/μ	
		2 l/m	11:58				" "	" "	MR	
A-63	7/23/01	LF3	10:20	11:20	100	250	" "	" "	0.0128/μ	
		2.5 l/m	12:00				" "	" "	MR	
A-64	7/23/01	LF1	10:22	11:22	100	200	" "	" "	0.0084/μ	
		2.0 l/m	12:02				" "	" "	MR	



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES00-005

PROJECT NAME: UGTP ABATEMENT

CLIENT: BOEING REACT Corp.

CONTRACTOR: TRI-STATE

PROJECT MANAGER: MIKE REZVANI

TECHNICIAN: MIKE REZVANI

SAMPLE NO	DATE	PUMP #	TIME ON		DURATION	VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			TIME ON	TIME OFF						
A-65	7/24/01	LF1	10:35	12:05	90	180	N.W. CORNER	MONITORING	0.008 f/c	MR
			2 l/m							
A-66	7/25/01	LF2	10:41	12:11	90	270	" "	" "	0.012 f/c	MR
			3 l/m							
A-67	7/30/01	LF1	10:40	12:40	120	240	" "	" "	<0.01 f/c	MR
			2 l/m							
A-68	7/31/01	LF1	10:22	12:02	100	200	" "	" "	0.022 f/c	MR
			2 l/m							
A-69	8/1/01	LF1	10:42	12:42	120	240	" "	" "	0.0073 f/c	MR
			2.0 l/m							
A-70	8/2/01	LF1	10:37	12:07	90	225	" "	" "	0.0137 f/c	MR
			2.5 l/m							
A-71	8/6/01	LF1	10:43	12:13	90	180	" "	" "	0.006 f/c	MR
			2 l/m							
A-72	8/6/01	LF2	10:43	12:13	90	180	" "	" "	0.015 f/c	MR
			2 l/m							



ENVIRONMENTAL SOLUTIONS

PLANNING • ENGINEERING • MANAGEMENT

2601 E. Chevy Chase Drive, Glendale, CA 91206

AIR SAMPLE DOCUMENTATION

JOB NUMBER: ES00-005

PROJECT NAME: UGTP ABATEMENT

CLIENT: BOEING REALTY CORP.

CONTRACTOR: TEI-STATE

PROJECT MANAGER: MIKE REZVANI

TECHNICIAN: MIKE REZVANI

SAMPLE NO	DATE	PUMP #	TIME		DURATION	VOLUME	LOCATION	OPERATION	AFC READER	QA/QC READER
			ON	OFF						
A-73	8/7/01	LF1	10:36	12:16	100	200 Lt	OWA / WEST	ABATEMENT	<0.01 f/u	
							OF ACTIVITIES	MONITORING	MR	
A-74	8/8/01	LF1	10:30	12:10	100	300 Lt	" "	" "	0.0156 f/u	
							" "	" "	MR	
A-75	8/9/01	LF1	10:05	12:05	120	240 Lt	" "	" "	0.012 f/u	
							" "	" "	MR	
A-76	8/13/01	LF1	10:15	12:15	120	240 Lt	" "	" "	0.020 f/u	
							" "	" "	MR	
A-77	8/14/01	LF1	10:00	11:05	65	130 Lt	" "	" "	<0.01 f/u	
							" "	" "	MR	
A-78	8/15/01	LF1	11:04	12:04	60	180 Lt	" "	" "	<0.01 f/u	
							" "	" "	0.022 f/u	MR
A-79	8/16/01	LF2	10:47	12:07	80	160 Lt	" "	" "	0.022 f/u	
							" "	" "	MR	
A-80	8/16/01	LF1	10:47	12:07	80	160 Lt	" "	" "	0.032 f/u	
							" "	" "	MR	

EXHIBIT III

HAZARDOUS MANIFESTS

NOTICE AND CERTIFICATION

The waste identified on manifest number 20711624 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: DOUGLASS AIRCRAFT CO M/S 0009/0020

ADDRESS: 190th & NORMANVILLE TERRACE, CA 90846

Benito Apkenso

Print name

[Signature]

Signature

[Signature]

Title

6-26-01

Date

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. C A D 0 8 6 5 1 0 0 0 5 1 0 0 0 1				Manifest Document No. 1 1 of 1		2. Page 1		Information in the shaded areas is not required by Federal law.			
		3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY M/S D009/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846						A. State Manifest Document Number 20711624		B. State Generator's ID			
4. Generator's Phone (562) 496-6524 CONTACT:						6. US EPA ID Number C A R 0 0 0 0 0 1 7 6 5 7		C. State Transporter's ID [Reserved.]		D. Transporter's Phone (626) 969-1384			
5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702						8. US EPA ID Number		E. State Transporter's ID [Reserved.]		F. Transporter's Phone			
7. Transporter 2 Company Name						10. US EPA ID Number C A D 0 0 9 0 0 7 6 2 6		G. State Facility's ID		H. Facility's Phone (626) 334-0719			
9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702						12. Containers No. Type 0 0 2 CM		13. Total Quantity 00040		14. Unit Y			
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number) REG. ASBESTOS, 9, NA 2212, PGIII						15. Waste Number State 151 EPA/Other		16. State		17. EPA/Other			
J. Additional Descriptions for Materials Listed Above FRIBLE ASBESTOS CONTAINING WASTE						K. Handling Codes for Wastes Listed Above a. 03		b.		c.			
15. Special Handling Instructions and Additional Information BDC 24 HRS EMERGENCY INFOTRAC 1-800-535-5053 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED) SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90846						16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations. If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.		Printed/Typed Name GERALD ADKERSON		Signature <i>Gerald Adkerson</i>		Month Day Year 06 26 01	
17. Transporter 1 Acknowledgement of Receipt of Materials						Printed/Typed Name MIKE ANSOLO		Signature <i>Mike Ansol</i>		Month Day Year 06 26 01			
18. Transporter 2 Acknowledgement of Receipt of Materials						Printed/Typed Name		Signature		Month Day Year			
19. Discrepancy Indication Space													
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19						Printed/Typed Name		Signature		Month Day Year			

DO NOT WRITE BELOW THIS LINE.

TRISTATE

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802. WITHIN CALIFORNIA, CALL 1-800-852-7550
 GENERATOR
 TRANSPORTER
 FACILITY

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. CA D 0 8 6 5 1 0 0 0 5 3 1 4 0 1		Manifest Document No.		2. Page 1 of 1		Information in the shaded areas is not required by Federal law.			
		3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT CO. M/SD 009/0020 3855 LAKEWOOD BLVD., LONG BEACH, CA. 90846		A. State Manifest Document Number 99831401		B. State Generator's ID					
4. Generator's Phone (562) 496-6524		5. Transporter 1 Company Name LIGHTING RESOURCES, INC.		6. US EPA ID Number CA L 0 0 0 0 8 2 7 7 5 8		C. State Transporter's ID [Reserved.]		D. Transporter's Phone (909) 923-7252			
7. Transporter 2 Company Name		8. US EPA ID Number		E. State Transporter's ID [Reserved.]		F. Transporter's Phone					
9. Designated Facility Name and Site Address LIGHTING RESOURCES, INC. 805 E. FRANCIS STREET ONTARIO, CA. 91761		10. US EPA ID Number CA L 0 0 0 0 8 2 7 7 5 8		G. State Facility's ID		H. Facility's Phone (909) 923-7252					
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number) a. RQ, ENVIRONMENTALLY HAZARDOUS SUBSTANCE, SOLID, N.O.S., 9, UN3077, PGIII, (CONTAINING: POLYCHLORINATED BIPHENYLS.)			12. Containers No. Type		13. Total Quantity		14. Unit Wt/Vol		I. Waste Number State 261 EPA/Other NON-RCRA State		
			0015 DM		025PP		P		EPA/Other		
b.									State*		
c.									EPA/Other		
d.									State		
									EPA/Other		
J. Additional Descriptions for Materials Listed Above 11a. USED LIGHT BALLAST CAPACITORS 100μ					K. Handling Codes for Wastes Listed Above a. --01-- b. c. d.						
15. Special Handling Instructions and Additional Information 24HR. EMERGENCY PHONE: (800) 424-9300 RQ= 1LB. ERG#171 WEAR APPROPRIATE PROTECTIVE EQUIPMENT AND EYEWEAR											
16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations. If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.											
Printed/Typed Name G. ...			Signature <i>[Signature]</i>			Month 02		Day 2		Year 2001	
17. Transporter 1 Acknowledgement of Receipt of Materials											
Printed/Typed Name David ...			Signature <i>[Signature]</i>			Month 02		Day 2		Year 2001	
18. Transporter 2 Acknowledgement of Receipt of Materials											
Printed/Typed Name			Signature			Month		Day		Year	
19. Discrepancy Indication Space											
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19.											
Printed/Typed Name			Signature			Month		Day		Year	

DO NOT WRITE BELOW THIS LINE.

Yellow: GENERATOR RETAINS

NOTICE AND CERTIFICATION

The waste identified on manifest number 20711023 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: Douglas Aircraft Company
ADDRESS: 140th & Normandale, Torrance, CA 90842

Carole Dore
Print name

[Signature]
Signature

3-20-01
Title

Date

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550
 GENERATOR
 TRANSPORTER
 FACILITY

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator's US EPA ID No. CAD0006510005100001 Manifest Document No. 1 of 1 2. Page 1 Information in the shaded areas is not required by Federal law.

3. Generator's Name and Mailing Address
DOUGLAS AIRCRAFT COMPANY M/S D009/0020
 3855 LAKEWOOD BL
 LONG BEACH, CA 90846
 4. Generator's Phone (562) 496-6524 CONTACT:

A. State Manifest Document Number **20711023**

5. Transporter 1 Company Name
BDC SPECIAL WASTE SERVICES
 766 S. AYON AZUSA, CA 91702
 6. US EPA ID Number CAD0000017657

B. State Generator's ID

C. State Transporter's ID [Reserved]

D. Transporter's Phone (526) 969-1384

7. Transporter 2 Company Name
 8. US EPA ID Number

E. State Transporter's ID [Reserved]

F. Transporter's Phone

9. Designated Facility Name and Site Address
AZUSA LAND RECLAMATION
 1201 W. GLADSTONE
 AZUSA, CA 91702
 10. US EPA ID Number CAD0009007626

G. State Facility's ID

H. Facility's Phone (626) 334-0719

11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)

12. Containers: No. Type 13. Total Quantity 14. Unit Wt/Vol 15. Waste Number

a. **FR, ASBESTOS, 9, NA 2212, PGIII**

1 drum 00030 Y State 151

b.

EPA/Other

c.

State

d.

EPA/Other

J. Additional Descriptions for Materials Listed Above
FRIABLE ASBESTOS CONTAINING WASTE

K. Handling Codes for Wastes Listed Above

a. 03 b.

c. d.

15. Special Handling Instructions and Additional Information
BDC 24HRS EMERGENCY# INFOTRAC 1-800-535-5053
EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305
ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED)
SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90846

16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.

If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.

Printed/Typed Name Gregory Advers... Signature [Signature] Month 01 Day 31 Year 2001

17. Transporter 1 Acknowledgement of Receipt of Materials
 Printed/Typed Name PEDRO MANGEL Signature [Signature] Month 01 Day 20 Year 2001

18. Transporter 2 Acknowledgement of Receipt of Materials
 Printed/Typed Name Signature Month Day Year

19. Discrepancy Indication Space

20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19
 Printed/Typed Name Signature Month Day Year

DO NOT WRITE BELOW THIS LINE. TRISTATE

NOTICE AND CERTIFICATION

The waste identified on manifest number 20659701 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: COUBLAS AIRCRAFT COMPANY MS. 0009 16020

ADDRESS: 3855 LAKWOOD BL LONG BEACH, CA 90846

Bernard Adickes

Print name

Signature

Title

Date

2-06-01

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802. WITHIN CALIFORNIA, CALL 1-800-852-7550

GENERATOR

TRANSPORTER

FACILITY

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. CAD0086510005100011		Manifest Document No. 1 of 1		2. Page 1		Information in the shaded areas is not required by Federal law.					
3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY M/S D009/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846						A. State Manifest Document Number 20659701							
4. Generator's Phone (562) 496-6524 CONTACT:						B. State Generator's ID							
5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702						C. State Transporter's ID [Reserved]							
6. US EPA ID Number CAR0000017657						D. Transporter's Phone (626) 969-1384							
7. Transporter 2 Company Name						E. State Transporter's ID [Reserved]							
8. US EPA ID Number						F. Transporter's Phone							
9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702						G. State Facility's ID							
10. US EPA ID Number CAD00900762E						H. Facility's Phone (626) 334-0719							
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number) a. AQ. ASBESTOS, 9, NA 2212, P6111						12. Containers No. Type		13. Total Quantity		14. Unit Wt/Vol		I. Waste Number	
						EPA/Other						State 151	
						EPA/Other						State	
						EPA/Other						State	
						EPA/Other						State	
Additional Descriptions for Materials Listed Above FRIABLE ASBESTOS CONTAINING WASTE						K. Handling Codes for Wastes Listed Above a. 03							
15. Special Handling Instructions and Additional Information BDC 24 HRS EMERGENCY# INFOTRAC 1-800-535 5053 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED) SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90546													
16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations. If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.													
Printed/Typed Name Gerris Armenta				Signature <i>[Signature]</i>				Month Day Year 12/20/01					
17. Transporter 1 Acknowledgement of Receipt of Materials													
Printed/Typed Name Tony Deha				Signature <i>[Signature]</i>				Month Day Year 12/20/01					
18. Transporter 2 Acknowledgement of Receipt of Materials													
Printed/Typed Name				Signature				Month Day Year					
19. Discrepancy Indication Space													
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19.													
Printed/Typed Name				Signature				Month Day Year					

DO NOT WRITE BELOW THIS LINE.

TRISTATE



766 S. AYON AVE. • AZUSA, CA 91702
(626) 969-1384 • FAX (626) 969-4971

NON-HAZARDOUS WASTE DATA FORM

TO BE COMPLETED BY GENERATOR

NAME DOUGLAS AIRCRAFT COMPANY M/S D009/0020 CONTACT: SITE: MCDONNELL DOUGLAS

ADDRESS 3855 LAKEWOOD BL EPA ID NO. CAD0086510005

CITY, STATE, ZIP LONG BEACH, CA 90846 PHONE NO. (562) 496-6524

CONTAINERS: No. 2 CM VOLUME/CY 1 Y WEIGHT/TONS _____

TYPE: ROLL-OFF TRUCK DUMP TRUCK DRUMS CARTONS OTHER Roll-off/ Cube Van

WASTE DESCRIPTION NON FRIABLE ASBESTOS GENERATING PROCESS REMOVAL

COMPONENTS OF WASTE	PPM %	COMPONENTS OF WASTE	PPM %
1. _____	_____	3. _____	_____
2. _____	_____	4. _____	_____

VOC-OVA READINGS _____

SITE ADDRESS 190TH & NORMANDIE TORRANCE, CA 90846

PROPERTIES: pH N/A SOLID LIQUID SLUDGE SLURRY OTHER TRISTATE

HANDLING INSTRUCTIONS: USE PROPER SAFETY EQUIPMENT

THE GENERATOR CERTIFIES THAT THE WASTE AS DESCRIBED IS 100% NON-HAZARDOUS.

George Arreola 12-20-00
TYPED OR PRINTED FULL NAME & SIGNATURE DATE

TRANSPORTER I

NAME BDC SPECIAL WASTE SERVICES EPA ID NO. CAR000017657

ADDRESS 766 S. AYON SERVICE ORDER NO. _____

CITY, STATE, ZIP AZUSA, CA 91702 PICK UP DATE _____

PHONE NO. (626) 969-1384 George Arreola 12-20-00
TYPED OR PRINTED FULL NAME & SIGNATURE DATE

TRANSPORTER II

NAME _____ EPA ID NO. _____

ADDRESS _____ SERVICE ORDER NO. _____

CITY, STATE, ZIP _____ PICK UP DATE _____

PHONE NO. () _____ TYPED OR PRINTED FULL NAME & SIGNATURE DATE

TSD FACILITY

NAME AZUSA LAND RECLAMATION EPA ID NO. CAD009037625 DISPOSAL METHOD

ADDRESS 1201 W. GLADSTONE LANDFILL OTHER _____

CITY, STATE, ZIP AZUSA, CA 91702

PHONE NO. (626) 334-0719 TYPED OR PRINTED FULL NAME & SIGNATURE DATE

GEN	OLD/NEW	L	A	TONS	SCAQMD 909 396 3456 21865 COPLEY, DIAMOND BAR
TRANS		S	B		
C/O		RT/CD		HWDF NONE	

DISCREPANCY _____

NOTICE AND CERTIFICATION

The waste identified on manifest number 20710164 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: DOUGLAS AIRCRAFT COMPANY M/S 000910010

ADDRESS: 190th & NORMAN AVE TORRANCE, CA 90504

Genovay Anderson
Print name

[Signature]
Signature

PM
Title

05-02-01
Date

NOTICE AND CERTIFICATION

The waste identified on manifest number 20710165 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: _____

ADDRESS: _____

CORRUS ADRIANSEN sign as agent

Print name _____

Signature _____

Title _____

Date _____

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. C A D 0 8 6 5 1 0 0 0 5 1 0 0 0 1		Manifest Document No. 1 0 0 0 1		2. Page 1 1 of 1		Information in the shaded areas is not required by Federal law.									
3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY M/S D009/0020 3055 LAKEWOOD BL LONG BEACH, CA 90846						A. State Manifest Document Number 20710165											
4. Generator's Phone (562) 496-6524 CONTACT:						B. State Generator's ID											
5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702						C. State Transporter's ID [Reserved]											
6. US EPA ID Number C A R 0 0 0 0 1 7 6 5 7						D. Transporter's Phone (626) 969-1384											
7. Transporter 2 Company Name						E. State Transporter's ID [Reserved]											
8. US EPA ID Number						F. Transporter's Phone											
9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702						G. State Facility's ID											
10. US EPA ID Number C A D 0 0 9 0 0 7 6 2 6						H. Facility's Phone (626) 334-0719											
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number) RG, ASBESTOS, 9, NA 2012, PGIII						12. Containers		13. Total		14. Unit		I. Waste Number					
						No.		Type		Quantity		Wt/Vol		State		EPA/Other	
										00000		Y		151			
						b.								State		EPA/Other	
						c.								State		EPA/Other	
d.								State		EPA/Other							
J. Additional Descriptions for Materials Listed Above FRAGILE ASBESTOS CONTAINING WASTE						K. Handling Codes for Wastes Listed Above											
						a. 03		b.		c.		d.					
L5. Special Handling Instructions and Additional Information BDC 24HRX EMERGENCY# INFOTRAC 1-800-535-5053 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED) SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90546																	
16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.																	
If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.																	
Printed/Typed Name Gerrit Anderson				Signature Gerrit Anderson				Month 015		Day 018		Year 01					
17. Transporter 1 Acknowledgement of Receipt of Materials																	
Printed/Typed Name Tesse Ruan				Signature Tesse Ruan				Month 015		Day 018		Year 01					
18. Transporter 2 Acknowledgement of Receipt of Materials																	
Printed/Typed Name				Signature				Month		Day		Year					
19. Discrepancy Indication Space																	
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19.																	
Printed/Typed Name				Signature				Month		Day		Year					

DO NOT WRITE BELOW THIS LINE.

TRISTATE



766 S. AYON AVE. • AZUSA, CA 91702
(626) 969-1384 • FAX (626) 969-4971

NON-HAZARDOUS WASTE DATA FORM

TO BE COMPLETED BY GENERATOR

NAME DOUGLAS AIRCRAFT COMPANY M/S D009/0020 CONTACT: SITE: MCDONNELL DOUGLAS
 ADDRESS 3855 LAKEWOOD BL EPA I.D. NO. CAD086510005
 CITY, STATE, ZIP LONG BEACH, CA 90846 PHONE NO. (562) 496-6524
 CONTAINERS: No. CM VOLUME/CY Y WEIGHT/TONS _____
 TYPE: ROLL-OFF TRUCK DUMP TRUCK DRUMS CARTONS OTHER Roll-off/ Cube Van
 WASTE DESCRIPTION NON FRIABLE ASBESTOS GENERATING PROCESS REMOVAL
 COMPONENTS OF WASTE PPM % COMPONENTS OF WASTE PPM %
 1. _____ 3. _____
 2. _____ 4. _____
 VOC-OVA READINGS _____
 SITE ADDRESS 190TH & NORMANDIE TORRANCE, CA 90846
 PROPERTIES: pH N/A SOLID LIQUID SLUDGE SLURRY OTHER TRISTATE
 HANDLING INSTRUCTIONS: USE PROPER SAFETY EQUIPMENT
 THE GENERATOR CERTIFIES THAT THE WASTE AS DESCRIBED IS 100% NON-HAZARDOUS.
 TYPED OR PRINTED FULL NAME & SIGNATURE _____ DATE _____

TRANSPORTER I

NAME BDC SPECIAL WASTE SERVICES EPA I.D. NO. CAR000017657
 ADDRESS 766 S. AYON SERVICE ORDER NO. _____
 CITY, STATE, ZIP AZUSA, CA 91702 PICK UP DATE _____
 PHONE NO. (626) 969-1384 TYPED OR PRINTED FULL NAME & SIGNATURE _____ DATE 12-27-00

TRANSPORTER II

NAME _____ EPA I.D. NO. _____
 ADDRESS _____ SERVICE ORDER NO. _____
 CITY, STATE, ZIP _____ PICK UP DATE _____
 PHONE NO. () _____ TYPED OR PRINTED FULL NAME & SIGNATURE _____ DATE _____

TSD FACILITY

NAME AZUSA LAND RECLAMATION EPA I.D. NO. CAD009007626 DISPOSAL METHOD _____
 ADDRESS 1201 W. GLADSTONE LANDFILL OTHER _____
 CITY, STATE, ZIP AZUSA, CA 91702
 PHONE NO. (626) 334-0719 TYPED OR PRINTED FULL NAME & SIGNATURE _____ DATE _____

GEN	OLD/NEW	L	A	TONS	SCAQMD 909 396 3456 21865 COPLEY, DIAMOND BAR
TRANS		S	B		
C/O		RT/CD	HWDF		

DISCREPANCY _____

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. C I A D 0 8 6 5 1 0 0 0 5 1 0 0 0		Manifest Document No. 0 1 1 of 1		2. Page 1		Information in the shaded areas is not required by Federal law.							
3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY M/S D009/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846						A. State Manifest Document Number 20710166									
4. Generator's Phone (562) 496-6524 CONTACT:						B. State Generator's ID									
5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702						C. State Transporter's ID [Reserved.]									
6. US EPA ID Number C I A R 0 0 0 0 1 7 6 5 7						D. Transporter's Phone (626) 969-1384									
7. Transporter 2 Company Name						E. State Transporter's ID [Reserved.]									
8. US EPA ID Number						F. Transporter's Phone									
9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702						10. US EPA ID Number C I A D 0 0 9 0 0 7 6 2 6									
G. State Facility's ID						H. Facility's Phone (626) 334-0719									
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)						12. Containers		13. Total Quantity		14. Unit W./Vol		I. Waste Number			
a. RG, ASBESTOS, 9, NA 2212, PG111						No.		Type				State			
						0 0 2		C M		0 0 0 0 1 5 Y		151			
												EPA/Other			
												State			
												EPA/Other			
b.										State					
c.												State			
d.												State			
EPA/Other															
J. Additional Descriptions for Materials Listed Above FRIABLE ASBESTOS CONTAINING WASTE						K. Handling Codes for Wastes Listed Above									
						a. 03		b.		c.		d.			
15. Special Handling Instructions and Additional Information BDC 24HRS EMERGENCY INFOTRAC 1-800-535-5053 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED) SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90846															
16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.															
If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.															
Printed/Typed Name Gerrita Adams				Signature <i>[Signature]</i>				Month Day Year 0 5 1 0 1 0 1							
17. Transporter 1 Acknowledgement of Receipt of Materials						Printed/Typed Name Rick Russell		Signature <i>[Signature]</i>		Month Day Year 0 5 1 0 1 0 1					
18. Transporter 2 Acknowledgement of Receipt of Materials						Printed/Typed Name		Signature		Month Day Year					
19. Discrepancy Indication Space															
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19:															
Printed/Typed Name				Signature				Month Day Year							

DO NOT WRITE BELOW THIS LINE. TRISTATE

NOTICE AND CERTIFICATION

The waste identified on manifest number 20710166 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

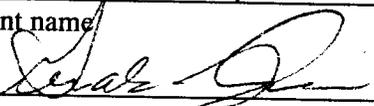
(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: DOUGLAS AIRCRAFT COMPANY M/S 000910020

ADDRESS: 190TH & NORMANDE TORRANCE, CA 90846

Gerris Adkinson
Print name

Signature
PM
Title
15-09-01
Date

NOTICE AND CERTIFICATION

The waste identified on manifest number 20712609 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: DOUGLAS AIRCRAFT COMPANY MS 300910020

ADDRESS: 190th & WASHINGTON TOWER, CA 90846

George Adams
Print name

Sign as agent
Signature

PM
Title

4-24-01
Date

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator's US EPA ID No. **CA D 0 8 G 5 1 1 0 0 0 5** Manifest Document No. **3 1 4 0 0** 2. Page 1 of 1 Information in the shaded areas is not required by Federal law.

3. Generator's Name and Mailing Address
DOUGLAS AIRCRAFT CO. M/SD 009/0020
3855 LAKEWOOD BLVD., LONG BEACH, CA. 90846
 4. Generator's Phone (562) 496-6524
 A. State Manifest Document Number **99831400**
 B. State Generator's ID

5. Transporter 1 Company Name **LIGHTING RESOURCES, INC.** 6. US EPA ID Number **CA L 0 0 0 8 2 7 7 5 8**
 C. State Transporter's ID [Reserved]
 D. Transporter's Phone **(909) 923-7252**
 7. Transporter 2 Company Name
 E. State Transporter's ID [Reserved]
 F. Transporter's Phone

9. Designated Facility Name and Site Address
LIGHTING RESOURCES, INC.
805 E. FRANCIS STREET
ONTARIO, CA. 91761
 10. US EPA ID Number **CA L 0 0 0 8 2 7 7 5 8**
 G. State Facility's ID
 H. Facility's Phone **(909) 923-7252**

11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)	12. Containers		13. Total Quantity	14. Unit Wt/Vol	15. Waste Number
	No.	Type			
a. RO, ENVIRONMENTALLY HAZARDOUS SUBSTANCE, SOLID, N.O.S., 9, UN3077, PGIII, (CONTAINING: POLYCHLORINATED BIPHENYLS.)	01214	D 15	119210	P	State 261 EPA/Other NON-RCRA
b.					State EPA/Other
c.					State EPA/Other
d.					State EPA/Other

J. Additional Descriptions for Materials Listed Above
11a. USED LIGHT BALLAST CAPACITORS 100%
 K. Handling Codes for Wastes Listed Above
 a. **-01-** b. c. d.

15. Special Handling Instructions and Additional Information
24HR. EMERGENCY PHONE: (800) 424-9300
RO- 1LB. ERG#174
WEAR APPROPRIATE PROTECTIVE EQUIPMENT AND EYEWEAR

16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.
 If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.

Printed/Typed Name *[Signature]* Signature *[Signature]* Month **01** Day **28** Year **01**

17. Transporter 1 Acknowledgement of Receipt of Materials
 Printed/Typed Name *[Signature]* Signature *[Signature]* Month **01** Day **28** Year **01**

18. Transporter 2 Acknowledgement of Receipt of Materials
 Printed/Typed Name Signature Month Day Year

19. Discrepancy Indication Space

20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19.
 Printed/Typed Name Signature Month Day Year

DO NOT WRITE BELOW THIS LINE.

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802. WITHIN CALIFORNIA, CALL 1-800-852-7550

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator's US EPA ID No. CA 028 B 6 S 1 0 0 0 5 1 0 0 0 1	Manifest Document No. 1 1 of 1	2. Page 1	Information in the shaded areas is not required by Federal law.
--	-----------------------------------	-----------	---

3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY M/S D009/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846	A. State Manifest Document Number 20711182
4. Generator's Phone (562) 496-6524 CONTACT:	B. State Generator's ID

5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702	6. US EPA ID Number CA R 0 0 0 0 1 7 6 5 7	C. State Transporter's ID [Reserved.]
7. Transporter 2 Company Name	8. US EPA ID Number	D. Transporter's Phone (626) 969-1384

9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702	10. US EPA ID Number CA D 0 0 9 0 0 7 6 2 6	E. State Transporter's ID [Reserved.]
		F. Transporter's Phone
		G. State Facility's ID
		H. Facility's Phone (626) 334-0719

11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)	12. Containers		13. Total Quantity	14. Unit Wt/Vol	1. Waste Number
	No.	Type			
a. RC, ASBESTOS, 9, NA 2212, PGIII	002	CM	00065	v	State 151 EPA/Other
b.					State EPA/Other
c.					State EPA/Other
d.					State EPA/Other

J. Additional Descriptions for Materials Listed Above FRIABLE ASBESTOS CONTAINING WASTE	K. Handling Codes for Wastes Listed Above a. 03 b. c. d.
--	--

15. Special Handling Instructions and Additional Information
 BDC 24HRS EMERGENCY# INFOTRAC 1-800-535-5053
 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305
 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED)
 SITE: MCDONNELL DOWGLAS 190TH & NORMANDIE TORRANCE, CA 90846

16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.

If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.

Printed/Typed Name Gerrit Aron	Signature <i>[Signature]</i>	Month Day Year 04/04/01
-----------------------------------	---------------------------------	----------------------------

17. Transporter 1 Acknowledgement of Receipt of Materials Printed/Typed Name RUBEN RODRIGUEZ	Signature <i>[Signature]</i>	Month Day Year 04/04/01
--	---------------------------------	----------------------------

18. Transporter 2 Acknowledgement of Receipt of Materials Printed/Typed Name	Signature	Month Day Year
---	-----------	----------------

19. Discrepancy Indication Space

20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 15. Printed/Typed Name	Signature	Month Day Year
---	-----------	----------------

DO NOT WRITE BELOW THIS LINE.

TRISTATE

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550

GENERATOR

TRANSPORTER

FACILITY

NOTICE AND CERTIFICATION

The waste identified on manifest number 20711182 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: DOUGLAS AIRCRAFT COMPANY M/S 0009/0020

ADDRESS: 3855 LINDWOOD BL. LONG BEACH, CA 90801

Charles Anderson
Print name
[Signature]
Signature
[Signature]
Title
4-04-01
Date

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550
 GENERATOR
 TRANSPORTER
 FACILITY

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. CAD0865100051000011		Manifest Document No. [REDACTED] Page 1 of 1		Information in the shaded areas is not required by Federal law.							
3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY M/S D009/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846				A. State Manifest Document Number 20710164									
4. Generator's Phone (562) 496-6524 CONTACT:				B. State Generator's ID									
5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702		6. US EPA ID Number CAR0000017657		C. State Transporter's ID [Reserved]									
7. Transporter 2 Company Name				D. Transporter's Phone (626) 969-1384									
9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702		10. US EPA ID Number CAD009007626		E. State Transporter's ID [Reserved]									
				F. Transporter's Phone									
				G. State Facility's ID									
				H. Facility's Phone (626) 334-0719									
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number) a. RB, ASBESTOS, 9, NA 2212, P6III						12. Contain-ers No. Type		13. Total Quantity		14. Unit Wt/Vol		1. Waste Number	
						002 CM		010080		Y		State 151	
												EPA/Other	
												State	
												EPA/Other	
J. Additional Descriptions for Materials Listed Above FRIBLE ASBESTOS CONTAINING WASTE						K. Handling Codes for Wastes Listed Above							
						a. 03		b.					
						c.		d.					
15. Special Handling Instructions and Additional Information BDC 24HR EMERGENCY INFOTRAC 1-800-335-5053 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED) SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90846													
16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations. If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.													
Printed/Typed Name GERALD ANDERSON				Signature <i>Gerald Anderson</i>				Month Day Year 05 10 2001					
17. Transporter 1 Acknowledgement of Receipt of Materials Printed/Typed Name JESSE RUM				Signature <i>Jesse Rum</i>				Month Day Year 05 10 2001					
18. Transporter 2 Acknowledgement of Receipt of Materials Printed/Typed Name				Signature				Month Day Year					
19. Discrepancy Indication Space													
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 15: Printed/Typed Name													
Signature				Month Day Year									

DO NOT WRITE BELOW THIS LINE. TRISTATE

NOTICE AND CERTIFICATION

The waste identified on manifest number 20712612 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: Douglas Aircraft Company
ADDRESS: 190th + Normandy, Torrance, CA 90846

Conrad Anderson
Print name

[Signature]
Signature

[Signature]
Title

4-23-01
Date

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator's US EPA ID No. CADW00E510005100011 Manifest Document No. 1 of 1
 2. Page 1 Information in the shaded areas is not required by Federal law.

3. Generator's Name and Mailing Address
 DOUGLAS AIRCRAFT COMPANY M/S D009/0022
 3855 LAKEWOOD BL
 LONG BEACH, CA 90846
 4. Generator's Phone (562) 496-6524 CONTACT:

A. State Manifest Document Number **20712609**

5. Transporter 1 Company Name
 BDC SPECIAL WASTE SERVICES
 766 S. AYON AZUSA, CA 91702
 6. US EPA ID Number CAR0000017657

B. State Generator's ID

7. Transporter 2 Company Name
 8. US EPA ID Number

C. State Transporter's ID [Reserved]

9. Designated Facility Name and Site Address
 AZUSA LAND RECLAMATION
 1201 W. GLADSTONE
 AZUSA, CA 91702
 10. US EPA ID Number CADW00E000762E

D. Transporter's Phone (626) 969-1384
 E. State Transporter's ID [Reserved]

F. Transporter's Phone
 G. State Facility's ID

H. Facility's Phone (626) 334-0719

11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)

12. Containers No. Type
 13. Total Quantity
 14. Unit Wt/Vol
 I. Waste Number

a. RG, ASBESTOS, 9, NA 2212, PGIII

0 0 1 CM 20040 Y
 State 151
 EPA/Other

b.

State
 EPA/Other

c.

State
 EPA/Other

d.

State
 EPA/Other

J. Additional Descriptions for Materials Listed Above
 FIBROUS ASBESTOS CONTAINING WASTE

K. Handling Codes for Wastes Listed Above
 a. 03
 b.
 c.
 d.

15. Special Handling Instructions and Additional Information
 BDC 24HRS EMERGENCY* INFOTRAC 1-800-535-5053
 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305
 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED)
 SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90546

16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.

If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.

Printed/Typed Name [Signature] Signature [Signature] Month 04 Day 24 Year 01

17. Transporter 1 Acknowledgement of Receipt of Materials
 Printed/Typed Name MIKE ANTONI Signature [Signature] Month 04 Day 24 Year 01

18. Transporter 2 Acknowledgement of Receipt of Materials
 Printed/Typed Name Signature Month Day Year

19. Discrepancy Indication Space

20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 15.

Printed/Typed Name Signature Month Day Year

DO NOT WRITE BELOW THIS LINE.

TRISTATE

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802: WITHIN CALIFORNIA, CALL 1-800-852-7550

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802. WITHIN CALIFORNIA, CALL 1-800-852-7550

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. CAD0086510005100001		Manifest Document No. 100001		2. Page 1 1 of 1		Information in the shaded areas is not required by Federal law.									
		3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY N/S D009/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846						A. State Manifest Document Number 20667191									
4. Generator's Phone (562) 496-6524 CONTACT:						B. State Generator's ID											
5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 765 S. AYON AZUSA, CA 91702				6. US EPA ID Number CAR0000017657		C. State Transporter's ID [Reserved]											
7. Transporter 2 Company Name						D. Transporter's Phone (626) 969-1384											
8. US EPA ID Number						E. State Transporter's ID [Reserved]											
9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702						10. US EPA ID Number CAD0009007626											
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)						12. Containers		13. Total Quantity		14. Unit Wt/Vol		I. Waste Number					
a. FR, ASBESTOS, 9, NA 2212, P6111						No.		Quantity		Wt/Vol		State					
						002		CM		00080		Y		151		EPA/Other	
														State		EPA/Other	
														State		EPA/Other	
														State		EPA/Other	
J. Additional Descriptions for Materials Listed Above FRIBLE ASBESTOS CONTAINING WASTE						K. Handling Codes for Wastes Listed Above a. 03											
15. Special Handling Instructions and Additional Information BDC 24HRS EMERGENCY# INFOTRAC 1-800-535-5053 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED) SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90846																	
16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations. If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.																	
Printed/Typed Name Gerald Adams				Signature <i>Gerald Adams</i>				Month Day Year 05/21/01									
17. Transporter 1 Acknowledgement of Receipt of Materials Printed/Typed Name Rob Rodriguez				Signature <i>Rob Rodriguez</i>				Month Day Year 05/01/01									
18. Transporter 2 Acknowledgement of Receipt of Materials Printed/Typed Name				Signature				Month Day Year									
19. Discrepancy Indication Space																	
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19 Printed/Typed Name																	
Signature				Month Day Year													

DO NOT WRITE BELOW THIS LINE.

TRISTATE

Yellow: GENERATOR RETAINS

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550
 GENERATOR
 TRANSPORTER
 FACILITY

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator's US EPA ID No. C A D 0 8 6 5 1 0 0 0 5 1 0 0 0 1		Manifest Document No.		2. Page 1 1 of 1		Information in the shaded areas is not required by Federal law.	
		3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY M/S D009/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846		6. US EPA ID Number C A R 0 0 0 0 1 7 6 5 7		A. State Manifest Document Number 20711926		B. State Generator's ID	
4. Generator's Phone (562) 496-6524 CONTACT*		7. Transporter 2 Company Name		8. US EPA ID Number		D. Transporter's Phone (626) 969-1384		E. State Transporter's ID [Reserved]	
5. Transporter 1 Company Name BDC SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702		9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702		10. US EPA ID Number C A D 0 0 9 0 0 7 6 2 6		F. Transporter's Phone		G. State Facility's ID	
11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)		12. Container: No. Type		13. Total Quantity		14. Unit Wt/Vol		I. Waste Number	
a. RG, ASBESTOS, 9, NA 2212, PGIII		0 0 2 0 1		00065		Y		State 151 EPA/Other	
b.								State EPA/Other	
c.								State EPA/Other	
d.								State EPA/Other	
J. Additional Descriptions for Materials Listed Above FRIBLE ASBESTOS CONTAINING WASTE		K. Handling Codes for Wastes Listed Above		a. 03		b.		c.	
15. Special Handling Instructions and Additional Information BDC 24-HRS EMERGENCY# INFOTRAC 1-800-535-5053 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED) SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90846									
16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations. If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.									
Printed/Typed Name Gerald Aronson		Signature <i>Gerald Aronson</i>		Month 07		Day 15		Year 2011	
17. Transporter 1 Acknowledgement of Receipt of Materials Printed/Typed Name Richard Roswell		Signature <i>Richard Roswell</i>		Month 07		Day 25		Year 2011	
18. Transporter 2 Acknowledgement of Receipt of Materials Printed/Typed Name		Signature		Month		Day		Year	
19. Discrepancy Indication Space									
20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19. Printed/Typed Name		Signature		Month		Day		Year	

DO NOT WRITE BELOW THIS LINE. TRISTATE

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator's US EPA ID No. CAD08651000510001	Manifest Document No. 1 of 1	2. Page 1	Information in the shaded areas is not required by Federal law.
---	---------------------------------	-----------	---

3. Generator's Name and Mailing Address DOUGLAS AIRCRAFT COMPANY N/S D029/0020 3855 LAKEWOOD BL LONG BEACH, CA 90846	A. State Manifest Document Number 20708293
---	--

4. Generator's Phone (562) 496-6524 CONTACT:	B. State Generator's ID
--	-------------------------

5. Transporter 1 Company Name BOE SPECIAL WASTE SERVICES 766 S. AYON AZUSA, CA 91702	6. US EPA ID Number CAR000017657	C. State Transporter's ID [Reserved]
--	-------------------------------------	--------------------------------------

7. Transporter 2 Company Name	8. US EPA ID Number	D. Transporter's Phone (626) 969-1384
-------------------------------	---------------------	--

9. Designated Facility Name and Site Address AZUSA LAND RECLAMATION 1201 W. GLADSTONE AZUSA, CA 91702	10. US EPA ID Number CAD009007E26	E. State Transporter's ID [Reserved]
--	--------------------------------------	--------------------------------------

		F. Transporter's Phone
		G. State Facility's ID
		H. Facility's Phone (626) 334-0719

11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)	12. Containers		13. Total Quantity	14. Unit Wt/Vol	I. Waste Number
	No.	Type			
a. RR, ASBESTOS, 9, NA 2212, PGIII	0	2 CM	00660	Y	State 151 EPA/Other
b.					State EPA/Other
c.					State EPA/Other
d.					State EPA/Other

J. Additional Descriptions for Materials Listed Above FRIBLE ASBESTOS CONTAINING WASTE	K. Handling Codes for Wastes Listed Above a. 03
---	--

15. Special Handling Instructions and Additional Information
 A/C 24HRS EMERGENCY# INFOTRAC 1-800-535-5053
 EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305
 ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED)
 SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90546

16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.

If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.

Printed/Typed Name <i>Rob...</i>	Signature <i>Rob...</i>	Month Day Year 06 07 01
-------------------------------------	----------------------------	----------------------------

17. Transporter 1 Acknowledgement of Receipt of Materials	Printed/Typed Name <i>Ken Brewster</i>	Signature <i>Ken Brewster</i>	Month Day Year 06 07 01
---	---	----------------------------------	----------------------------

18. Transporter 2 Acknowledgement of Receipt of Materials	Printed/Typed Name	Signature	Month Day Year
---	--------------------	-----------	----------------

19. Discrepancy Indication Space

20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19.	Printed/Typed Name	Signature	Month Day Year
---	--------------------	-----------	----------------

DO NOT WRITE BELOW THIS LINE. TRISTATE

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550

UNIFORM HAZARDOUS WASTE MANIFEST

1. Generator's US EPA ID No. **CAD08651000510001** Manifest Document No. **1 of 1**
 2. Page 1

Information in the shaded areas is not required by Federal law.

3. Generator's Name and Mailing Address
DOUGLAS AIRCRAFT COMPANY M/S D003/0020
3855 LAKEWOOD BL
LONG BEACH, CA 90846

A. State Manifest Document Number
20710052

4. Generator's Phone (562) 496-6524 CONTACT:

B. State Generator's ID

5. Transporter 1 Company Name
BDC SPECIAL WASTE SERVICES
766 S. AYON AZUSA, CA 91702

6. US EPA ID Number
CAR0002017657

C. State Transporter's ID [Reserved.]

7. Transporter 2 Company Name

8. US EPA ID Number

D. Transporter's Phone
(626) 969-1384

E. State Transporter's ID [Reserved.]

9. Designated Facility Name and Site Address
AZUSA LAND RECLAMATION
1201 W. GLADSTONE
AZUSA, CA 91702

10. US EPA ID Number
CAD00090076216

F. Transporter's Phone

G. State Facility's ID

H. Facility's Phone
(626) 334-0719

11. US DOT Description (including Proper Shipping Name, Hazard Class, and ID Number)

12. Contain. No.	13. Total Quantity	14. Unit Wt./Vol	15. Waste Number
002CM	010060	Y	State 151 EPA/Other

RQ, ASBESTOS, 9, NA 2012, P6III

b.				State
c.				EPA/Other
d.				State
				EPA/Other

J. Additional Descriptions for Materials Listed Above

FRIABLE ASBESTOS CONTAINING WASTE

K. Handling Codes for Wastes Listed Above

a. **03**
 b.
 c.
 d.

15. Special Handling Instructions and Additional Information

BDC 24HRS EMERGENCY# INFOTRAC 1-800-535-5253
EPA REGION IX 75 HAWTHORNE ST. SAN FRANCISCO, CA 94105 (415) 744-1305
ASBESTOS REMOVAL REQUIREMENT 40CFR61 (BAGGED SEALED & LABELED)
SITE: MCDONNELL DOUGLAS 190TH & NORMANDIE TORRANCE, CA 90846

16. GENERATOR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by proper shipping name and are classified, packed, marked, and labeled, and are in all respects in proper condition for transport by highway according to applicable international and national government regulations.

If I am a large quantity generator, I certify that I have a program in place to reduce the volume and toxicity of waste generated to the degree I have determined to be economically practicable and that I have selected the practicable method of treatment, storage, or disposal currently available to me which minimizes the present and future threat to human health and the environment; OR, if I am a small quantity generator, I have made a good faith effort to minimize my waste generation and select the best waste management method that is available to me and that I can afford.

Printed/Typed Name: *[Signature]* Signature: *[Signature]* Month: **04** Day: **16** Year: **01**

17. Transporter 1 Acknowledgement of Receipt of Materials
 Printed/Typed Name: **ROGERIO RODRIGUEZ** Signature: *[Signature]* Month: **04** Day: **16** Year: **01**

18. Transporter 2 Acknowledgement of Receipt of Materials
 Printed/Typed Name: Signature: Month: Day: Year:

19. Discrepancy Indication Space

20. Facility Owner or Operator Certification of receipt of hazardous materials covered by this manifest except as noted in Item 19.
 Printed/Typed Name: Signature: Month: Day: Year:

DO NOT WRITE BELOW THIS LINE. TRISTATE

IN CASE OF EMERGENCY OR SPILL, CALL THE NATIONAL RESPONSE CENTER 1-800-424-8802; WITHIN CALIFORNIA, CALL 1-800-852-7550

NOTICE AND CERTIFICATION

The waste identified on manifest number 20710052 and bearing California Waste Code 151 is subject to land disposal restrictions contained in CCR Title 22, Chapter 18, Article I. The waste meets the definition of a treated hazardous waste pursuant to Health and Safety Code, Section 25179.3 (1)(2), which states that waste is considered treated if the waste does not contain any substances above the Soluble Thresholds Limit Concentration values established in CCR Title 22, Chapter 18, Article II; and the waste is not prohibited from land disposal as provided in Health and Safety Code, Section 25179.6.

(waste analysis is attached for these wastes, where available)

As required by CCR Title 22, Chapter 18, Article I, the following certification is made for these wastes:

I warrant that I am an authorized representative of the generator. I certify under penalty of the law that the waste complies with the treatment standards specified in California Code of Regulations, Title 22, Division 4.5, Chapter 18, Section 66268.114. I believe that the information I submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting a false certification, including the possibility of a fine and imprisonment.

GENERATOR: DOUGLAS AIRCRAFT COMPANY

ADDRESS: 19011 & NORMANIE TORRANCE, CA 90546

Print name Gregory Anderson

Signature [Handwritten Signature]

Title 4-26-01

Date

